



# SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

<b>Unique Test ID</b>	109	<b>Date:</b>	9/2/2004	<b>MeterBasin:</b>	01_WR22
<b>Observer ID:</b>	B	<b>Crew:</b>	T-1	<b>Dye Test Recommended:</b>	N
<b>Defect No:</b>	1	<b>Setup No:</b>	5	<b>Priority CCTV:</b>	

<b>House Number</b>	<b>Street Prefix:</b>	<b>Street Name:</b>	<b>Street Type:</b>
3407		Ludgate	ROAD

<b>Source Type:</b>	02= Service Line	<b>Location:</b>	5=Sidewalk	<b>Severity:</b>
<b>Sector:</b>	1=Public	<b>Drainage Area:</b>	125	

**Comments:** crack in sidewalk

## SMOKE TEST PHOTOS



**Photo No:** 31

**Filename Path:**

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke  
Testing\Pictures\0902-2004\T-1\PLAYER\_B\B\_2004\_0902Image0031.JPG

**Image Status:** Image found and displayed.



**Photo No:** 32

**Filename Path:**

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke  
Testing\Pictures\0902-2004\T-1\PLAYER\_B\B\_2004\_0902Image0032.JPG

**Image Status:** Image found and displayed.

**Photo No:**

**Filename Path:**


**Image Status:** No image name specified.



# SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

## FIELD SKETCH

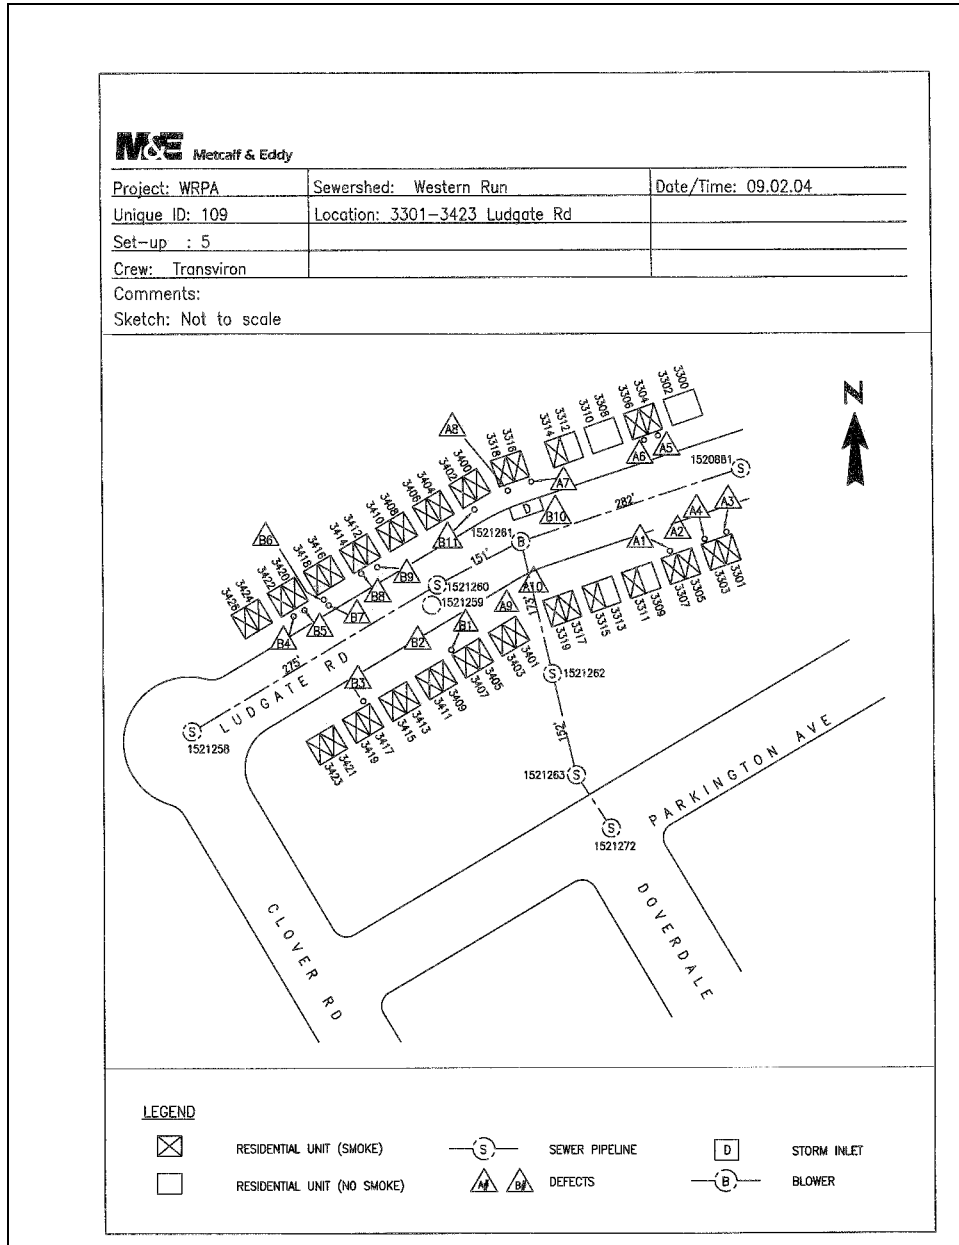

**Sketch No:** 109

### Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\109.tif

**Image Status:** Image found and displayed.

*NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.*



# SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

<b>Unique Test ID</b>	109	<b>Date:</b>	9/2/2004	<b>MeterBasin:</b>	01_WR22
<b>Observer ID:</b>	B	<b>Crew:</b>	T-1	<b>Dye Test Recommended:</b>	Y
<b>Defect No:</b>	10	<b>Setup No:</b>	5	<b>Priority CCTV:</b>	

<b>House Number</b>	<b>Street Prefix:</b>	<b>Street Name:</b>	<b>Street Type:</b>
3318		Ludgate	ROAD

<b>Source Type:</b>	14= Catch Basin	<b>Location:</b>	6=Curb	<b>Severity:</b>
---------------------	-----------------	------------------	--------	------------------

<b>Sector:</b>	1=Public	<b>Drainage Area:</b>	19200
----------------	----------	-----------------------	-------

**Comments:** drainage=street

## SMOKE TEST PHOTOS




**Photo No:** 46

**Filename Path:**

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke  
Testing\Pictures\0902-2004\T-1\PLAYER\_B\B\_2004\_0902Image0046.JPG

**Image Status:** Image found and displayed.

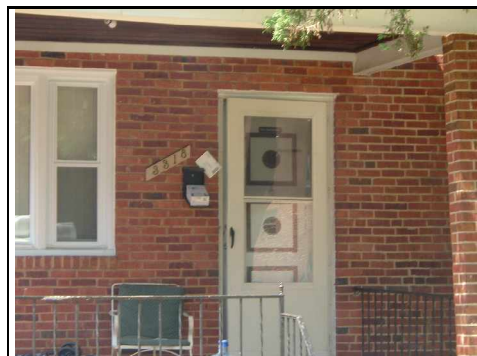

**Photo No:** 47

**Filename Path:**

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke  
Testing\Pictures\0902-2004\T-1\PLAYER\_B\B\_2004\_0902Image0047.JPG

**Image Status:** Image found and displayed.

**Photo No:**

**Filename Path:**


**Image Status:** No image name specified.



# SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

## FIELD SKETCH

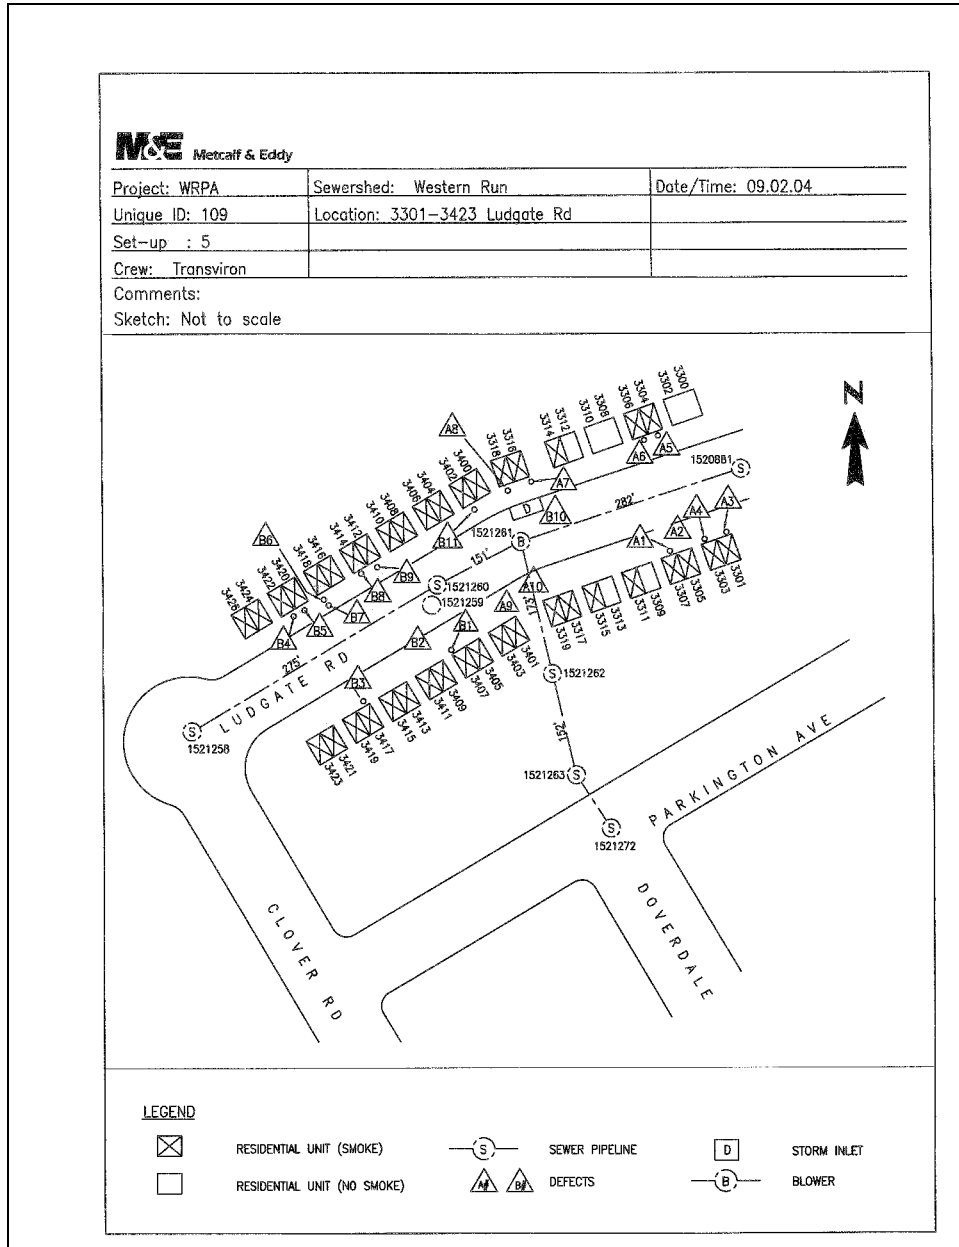

Sketch No: 109

### Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\109.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



# SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

<b>Unique Test ID</b>	109	<b>Date:</b>	9/2/2004	<b>MeterBasin:</b>	01_WR22
<b>Observer ID:</b>	B	<b>Crew:</b>	T-1	<b>Dye Test Recommended:</b>	N
<b>Defect No:</b>	11	<b>Setup No:</b>	5	<b>Priority CCTV:</b>	

<b>House Number</b>	<b>Street Prefix:</b>	<b>Street Name:</b>	<b>Street Type:</b>
3402		Ludgate	ROAD

<b>Source Type:</b>	02= Service Line	<b>Location:</b>	7=Yard-Front	<b>Severity:</b>
<b>Sector:</b>	2=Private	<b>Drainage Area:</b>	50	

**Comments:** hole in ground

## SMOKE TEST PHOTOS



**Photo No:** 48

**Filename Path:**

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke  
Testing\Pictures\0902-2004\T-1\PLAYER\_B\B\_2004\_0902Image0048.JPG

**Image Status:** Image found and displayed.



**Photo No:** 49

**Filename Path:**

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke  
Testing\Pictures\0902-2004\T-1\PLAYER\_B\B\_2004\_0902Image0049.JPG

**Image Status:** Image found and displayed.

**Photo No:**

**Filename Path:**

**Image Status:** No image name specified.






# SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

## FIELD SKETCH

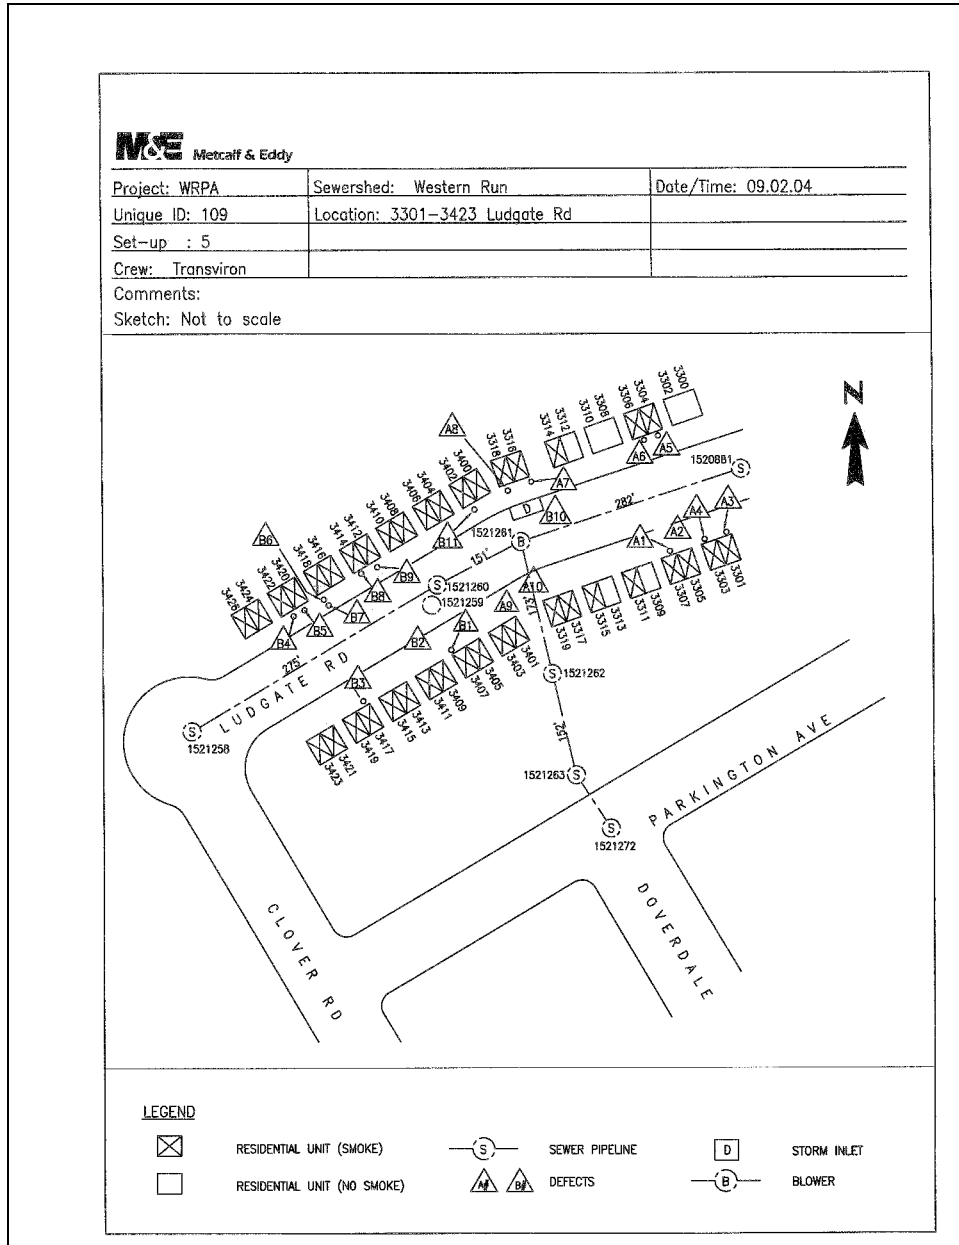

Sketch No: 109

### Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\109.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



# SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

<b>Unique Test ID</b>	109	<b>Date:</b>	9/2/2004	<b>MeterBasin:</b>	01_WR22
<b>Observer ID:</b>	B	<b>Crew:</b>	T-1	<b>Dye Test Recommended:</b>	N
<b>Defect No:</b>	2	<b>Setup No:</b>	5	<b>Priority CCTV:</b>	

<b>House Number</b>	<b>Street Prefix:</b>	<b>Street Name:</b>	<b>Street Type:</b>
3409		Ludgate	ROAD

<b>Source Type:</b>	04= Cleanout	<b>Location:</b>	7=Yard-Front	<b>Severity:</b>
<b>Sector:</b>	2=Private	<b>Drainage Area:</b>	125	

**Comments:**

## SMOKE TEST PHOTOS



**Photo No:** 33

**Filename Path:**

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke  
Testing\Pictures\0902-2004\T-1\PLAYER\_B\B\_2004\_0902Image0033.JPG

**Image Status:** Image found and displayed.



**Photo No:** 34

**Filename Path:**

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke  
Testing\Pictures\0902-2004\T-1\PLAYER\_B\B\_2004\_0902Image0034.JPG

**Image Status:** Image found and displayed.

**Photo No:**

**Filename Path:**


**Image Status:** No image name specified.



# SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

## FIELD SKETCH

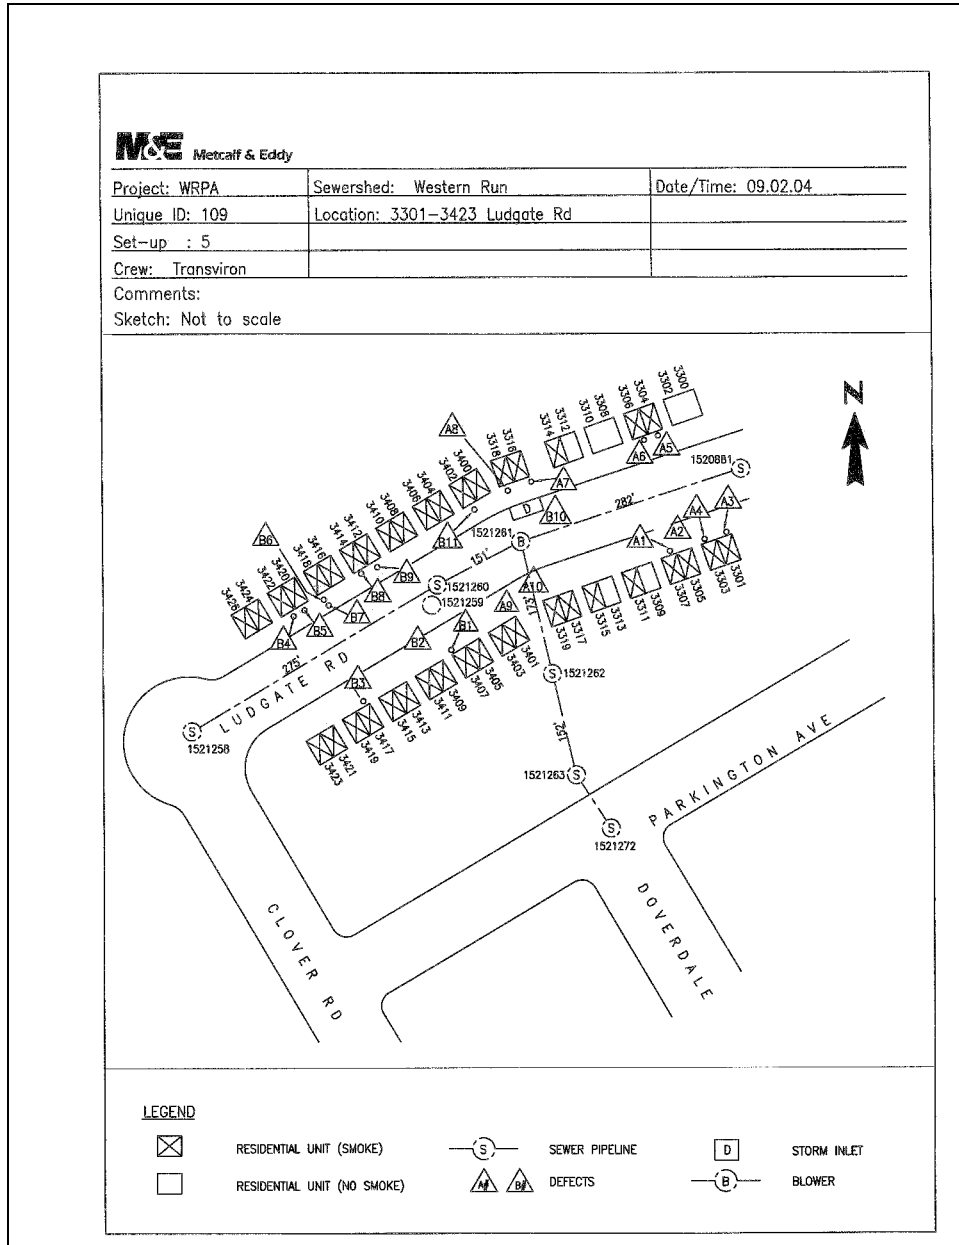

Sketch No: 109

### Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\109.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.





# SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

<b>Unique Test ID</b>	109	<b>Date:</b>	9/2/2004	<b>MeterBasin:</b>	01_WR22
<b>Observer ID:</b>	B	<b>Crew:</b>	T-1	<b>Dye Test Recommended:</b>	N
<b>Defect No:</b>	3	<b>Setup No:</b>	5	<b>Priority CCTV:</b>	

<b>House Number</b>	<b>Street Prefix:</b>	<b>Street Name:</b>	<b>Street Type:</b>
3417		Ludgate	ROAD

<b>Source Type:</b>	04= Cleanout	<b>Location:</b>	7=Yard-Front	<b>Severity:</b>
<b>Sector:</b>	2=Private	<b>Drainage Area:</b>	125	

**Comments:**

## SMOKE TEST PHOTOS




**Photo No:** 35

**Filename Path:**

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke  
Testing\Pictures\0902-2004\T-1\PLAYER\_B\B\_2004\_0902Image0035.JPG

**Image Status:** Image found and displayed.

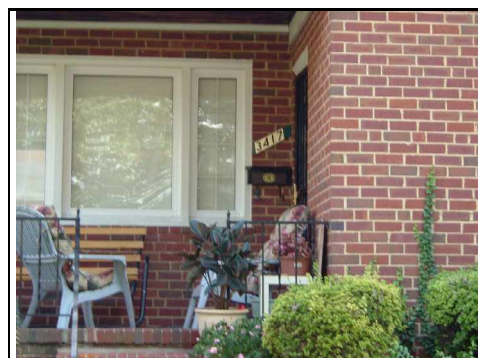

**Photo No:** 36

**Filename Path:**

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke  
Testing\Pictures\0902-2004\T-1\PLAYER\_B\B\_2004\_0902Image0036.JPG

**Image Status:** Image found and displayed.

**Photo No:**

**Filename Path:**


**Image Status:** No image name specified.



# SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

## FIELD SKETCH

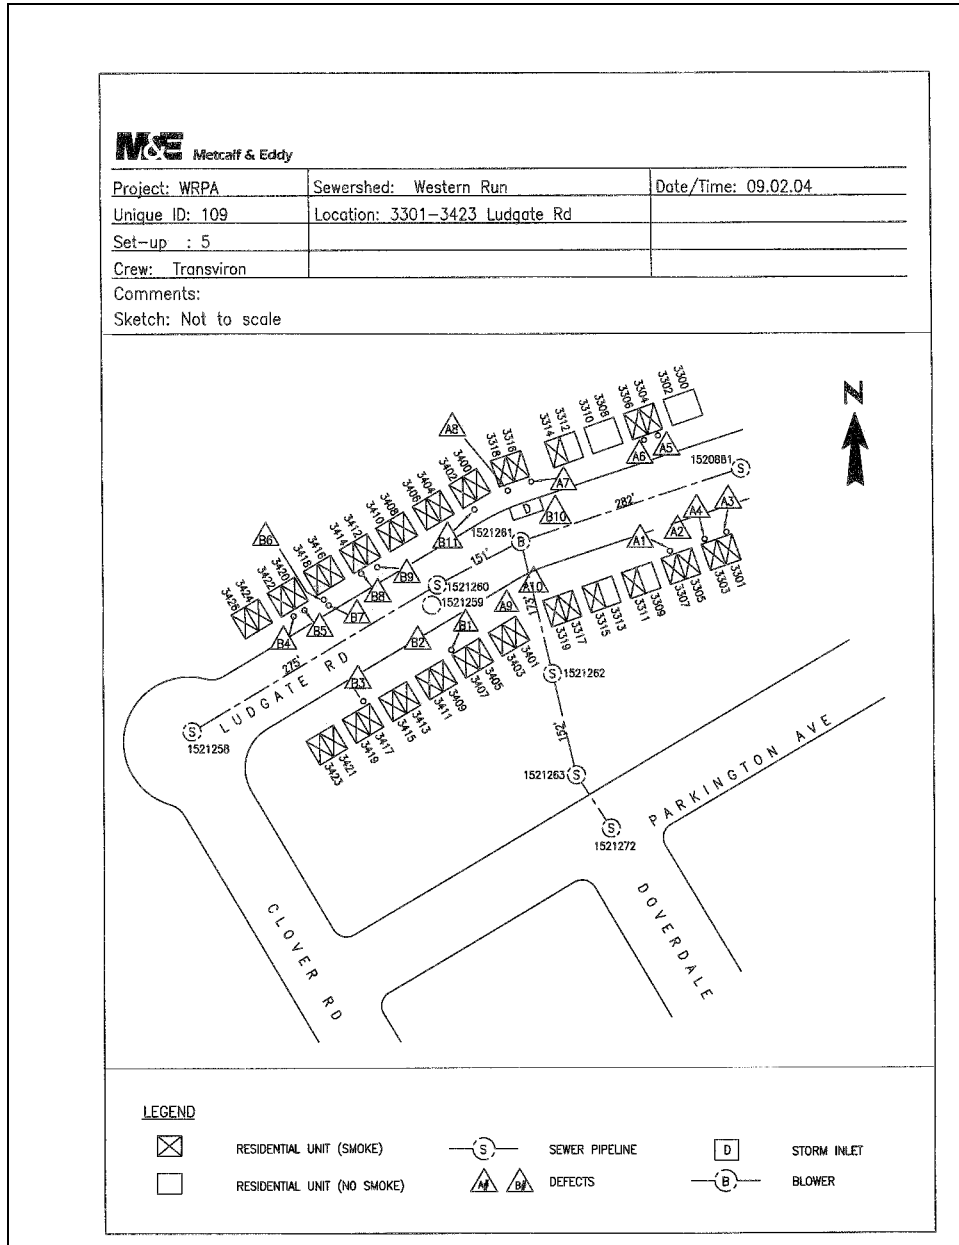

Sketch No: 109

### Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\109.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



# SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

<b>Unique Test ID</b>	109	<b>Date:</b>	9/2/2004	<b>MeterBasin:</b>	01_WR22
<b>Observer ID:</b>	B	<b>Crew:</b>	T-1	<b>Dye Test Recommended:</b>	N
<b>Defect No:</b>	4	<b>Setup No:</b>	5	<b>Priority CCTV:</b>	

<b>House Number</b>	<b>Street Prefix:</b>	<b>Street Name:</b>	<b>Street Type:</b>
3422		Ludgate	ROAD

<b>Source Type:</b>	04= Cleanout	<b>Location:</b>	7=Yard-Front	<b>Severity:</b>
<b>Sector:</b>	2=Private	<b>Drainage Area:</b>	75	

**Comments:**

## SMOKE TEST PHOTOS




**Photo No:** 37

**Filename Path:**

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke  
Testing\Pictures\0902-2004\T-1\PLAYER\_B\B\_2004\_0902Image0037.JPG

**Image Status:** Image found and displayed.

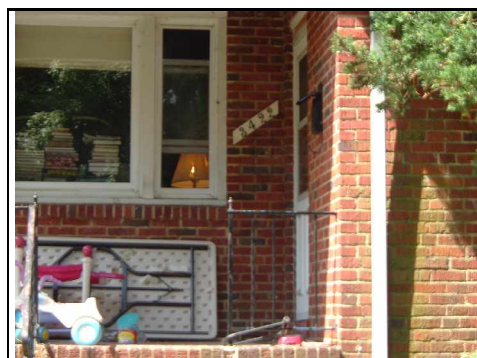

**Photo No:** 38

**Filename Path:**

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke  
Testing\Pictures\0902-2004\T-1\PLAYER\_B\B\_2004\_0902Image0038.JPG

**Image Status:** Image found and displayed.

**Photo No:**

**Filename Path:**


**Image Status:** No image name specified.



# SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

## FIELD SKETCH

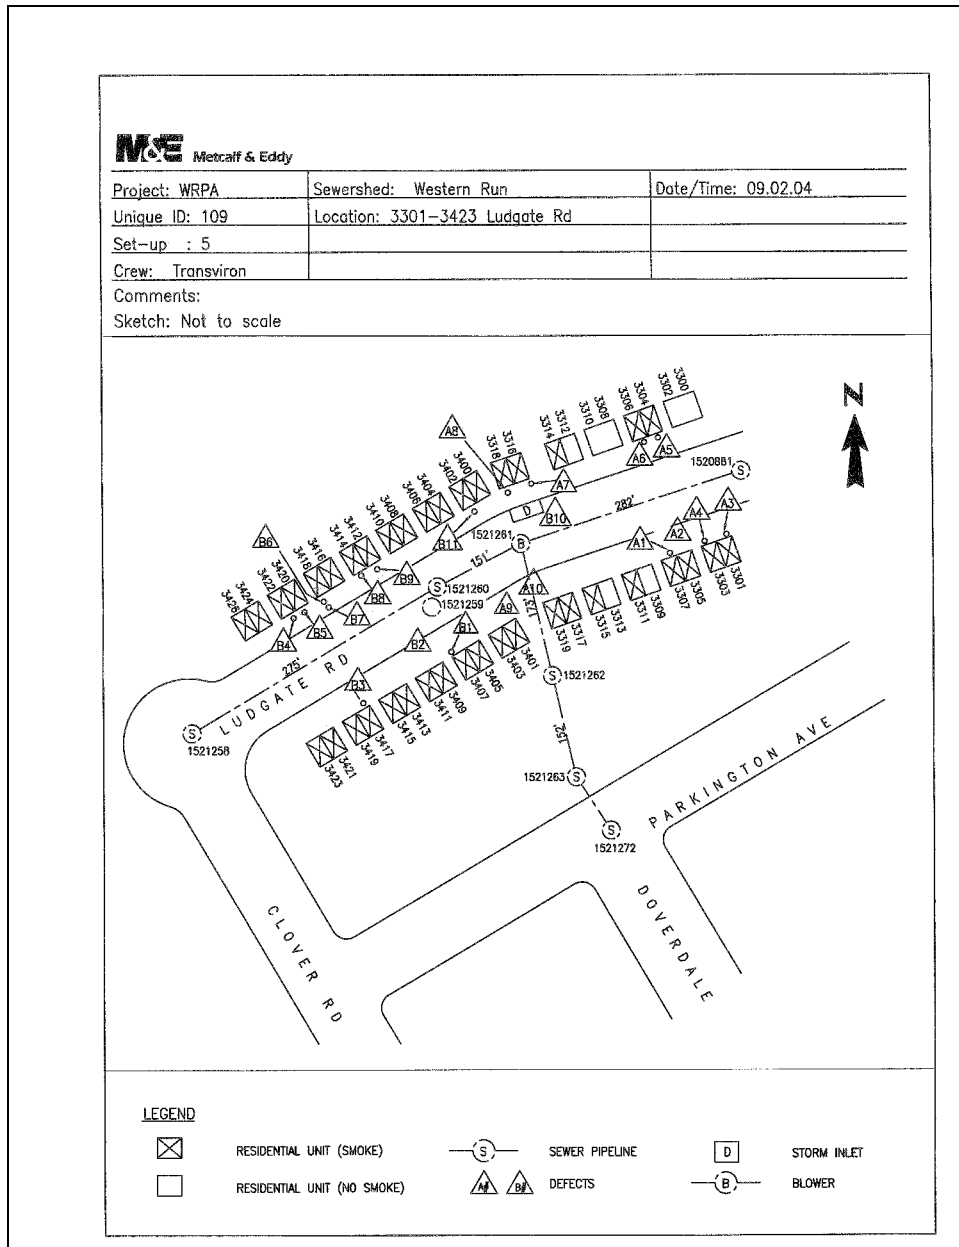

Sketch No: 109

### Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\109.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.





# SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland


<b>Unique Test ID</b>	109	<b>Date:</b>	9/2/2004	<b>MeterBasin:</b>	01_WR22
<b>Observer ID:</b>	B	<b>Crew:</b>	T-1	<b>Dye Test Recommended:</b>	N
<b>Defect No:</b>	5	<b>Setup No:</b>	5	<b>Priority CCTV:</b>	

<b>House Number</b>	<b>Street Prefix:</b>	<b>Street Name:</b>	<b>Street Type:</b>
3420		Ludgate	ROAD

<b>Source Type:</b>	04= Cleanout	<b>Location:</b>	7=Yard-Front	<b>Severity:</b>
<b>Sector:</b>	2=Private	<b>Drainage Area:</b>	0	

**Comments:**

## SMOKE TEST PHOTOS

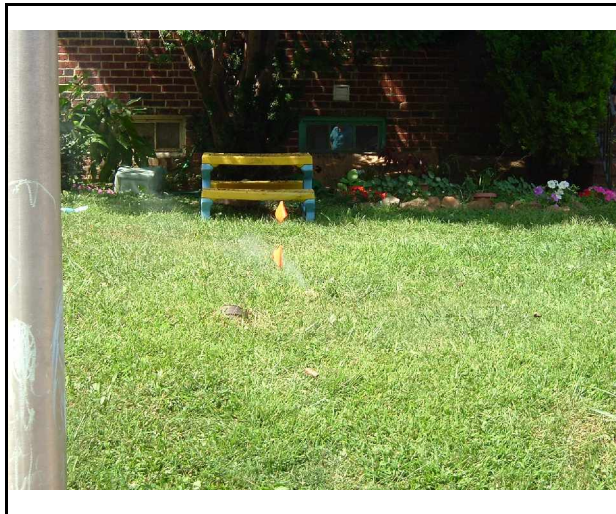

**Photo No:** 37

**Filename Path:**

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke  
Testing\Pictures\0902-2004\T-1\PLAYER\_B\B\_2004\_0902Image0037.JPG

**Image Status:** Image found and displayed.



**Photo No:** 39

**Filename Path:**

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke  
Testing\Pictures\0902-2004\T-1\PLAYER\_B\B\_2004\_0902Image0039.JPG

**Image Status:** Image found and displayed.

**Photo No:**

**Filename Path:**

**Image Status:** No image name specified.






# SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

## FIELD SKETCH

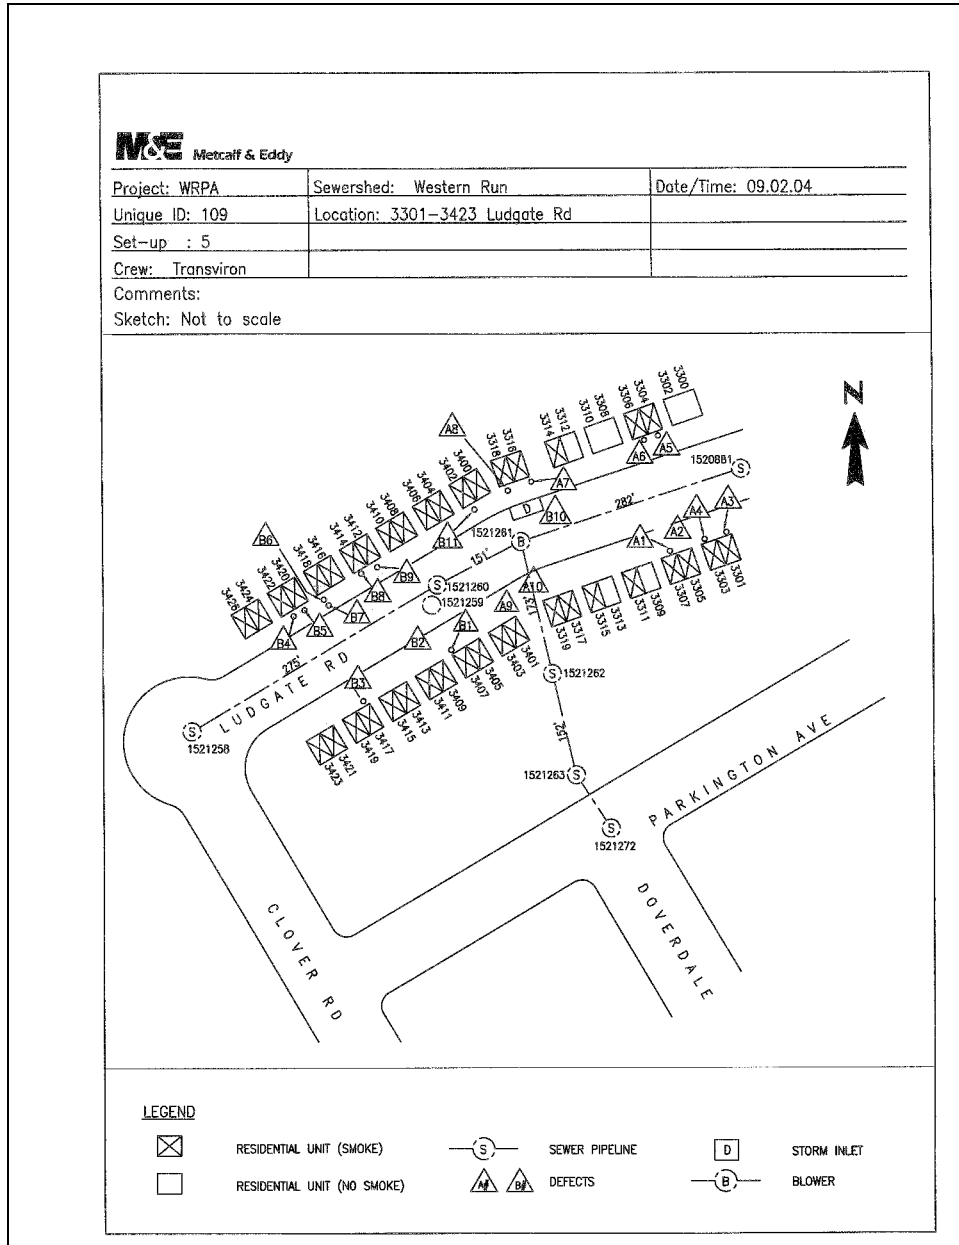

Sketch No: 109

### Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\109.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



# SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

<b>Unique Test ID</b>	109	<b>Date:</b>	9/2/2004	<b>MeterBasin:</b>	01_WR22
<b>Observer ID:</b>	B	<b>Crew:</b>	T-1	<b>Dye Test Recommended:</b>	N
<b>Defect No:</b>	6	<b>Setup No:</b>	5	<b>Priority CCTV:</b>	

<b>House Number</b>	<b>Street Prefix:</b>	<b>Street Name:</b>	<b>Street Type:</b>
3418		Ludgate	ROAD

<b>Source Type:</b>	04= Cleanout	<b>Location:</b>	7=Yard-Front	<b>Severity:</b>
<b>Sector:</b>	2=Private	<b>Drainage Area:</b>	0	

**Comments:**

## SMOKE TEST PHOTOS




**Photo No:** 40

**Filename Path:**

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke  
Testing\Pictures\0902-2004\T-1\PLAYER\_B\B\_2004\_0902Image0040.JPG

**Image Status:** Image found and displayed.

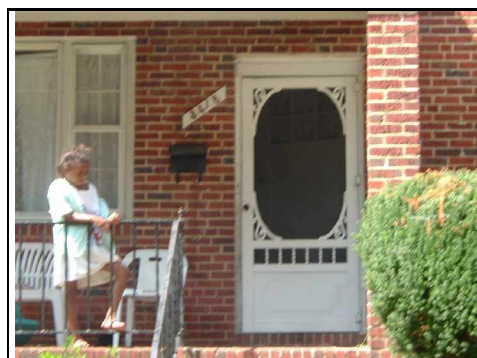

**Photo No:** 41

**Filename Path:**

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke  
Testing\Pictures\0902-2004\T-1\PLAYER\_B\B\_2004\_0902Image0041.JPG

**Image Status:** Image found and displayed.

**Photo No:**

**Filename Path:**


**Image Status:** No image name specified.



# SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

## FIELD SKETCH

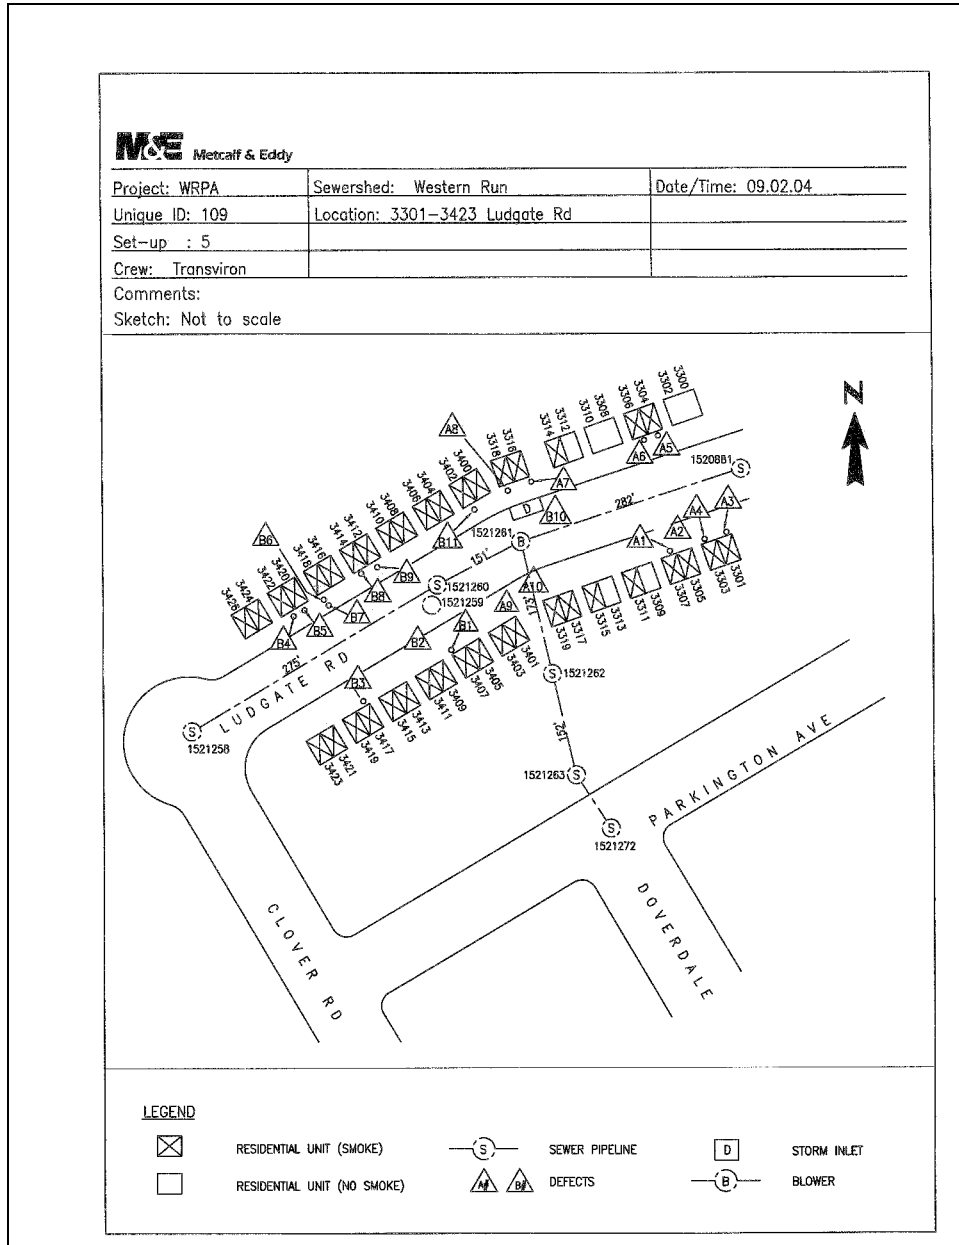

Sketch No: 109

### Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\109.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



# SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland


<b>Unique Test ID</b>	109	<b>Date:</b>	9/2/2004	<b>MeterBasin:</b>	01_WR22
<b>Observer ID:</b>	B	<b>Crew:</b>	T-1	<b>Dye Test Recommended:</b>	N
<b>Defect No:</b>	7	<b>Setup No:</b>	5	<b>Priority CCTV:</b>	

<b>House Number</b>	<b>Street Prefix:</b>	<b>Street Name:</b>	<b>Street Type:</b>
3418		Ludgate	ROAD

<b>Source Type:</b>	02= Service Line	<b>Location:</b>	7=Yard-Front	<b>Severity:</b>
<b>Sector:</b>	2=Private	<b>Drainage Area:</b>	0	

**Comments:** front porch

## SMOKE TEST PHOTOS

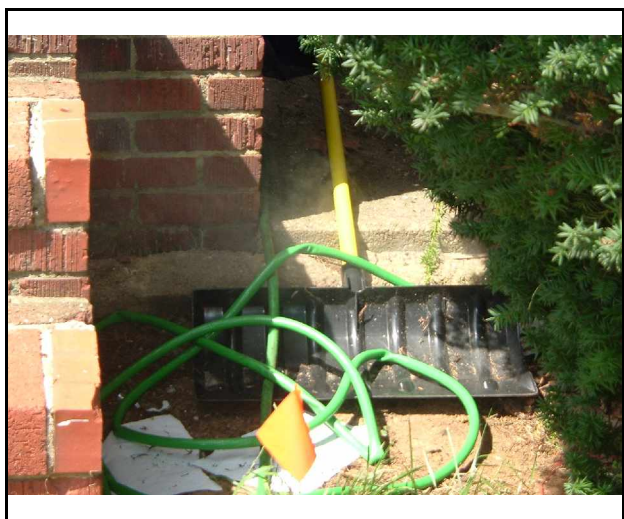


**Photo No:** 42

**Filename Path:**

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke  
Testing\Pictures\0902-2004\T-1\PLAYER\_B\B\_2004\_0902Image0042.JPG

**Image Status:** Image found and displayed.

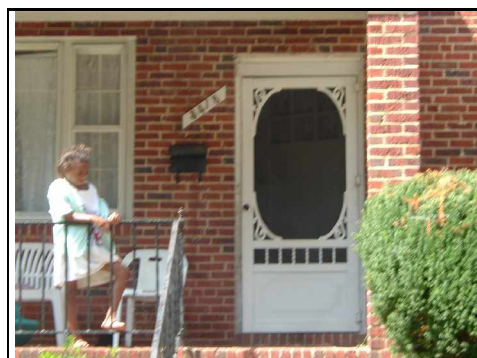

**Photo No:** 41

**Filename Path:**

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke  
Testing\Pictures\0902-2004\T-1\PLAYER\_B\B\_2004\_0902Image0041.JPG

**Image Status:** Image found and displayed.

**Photo No:**

**Filename Path:**


**Image Status:** No image name specified.



# SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

## FIELD SKETCH

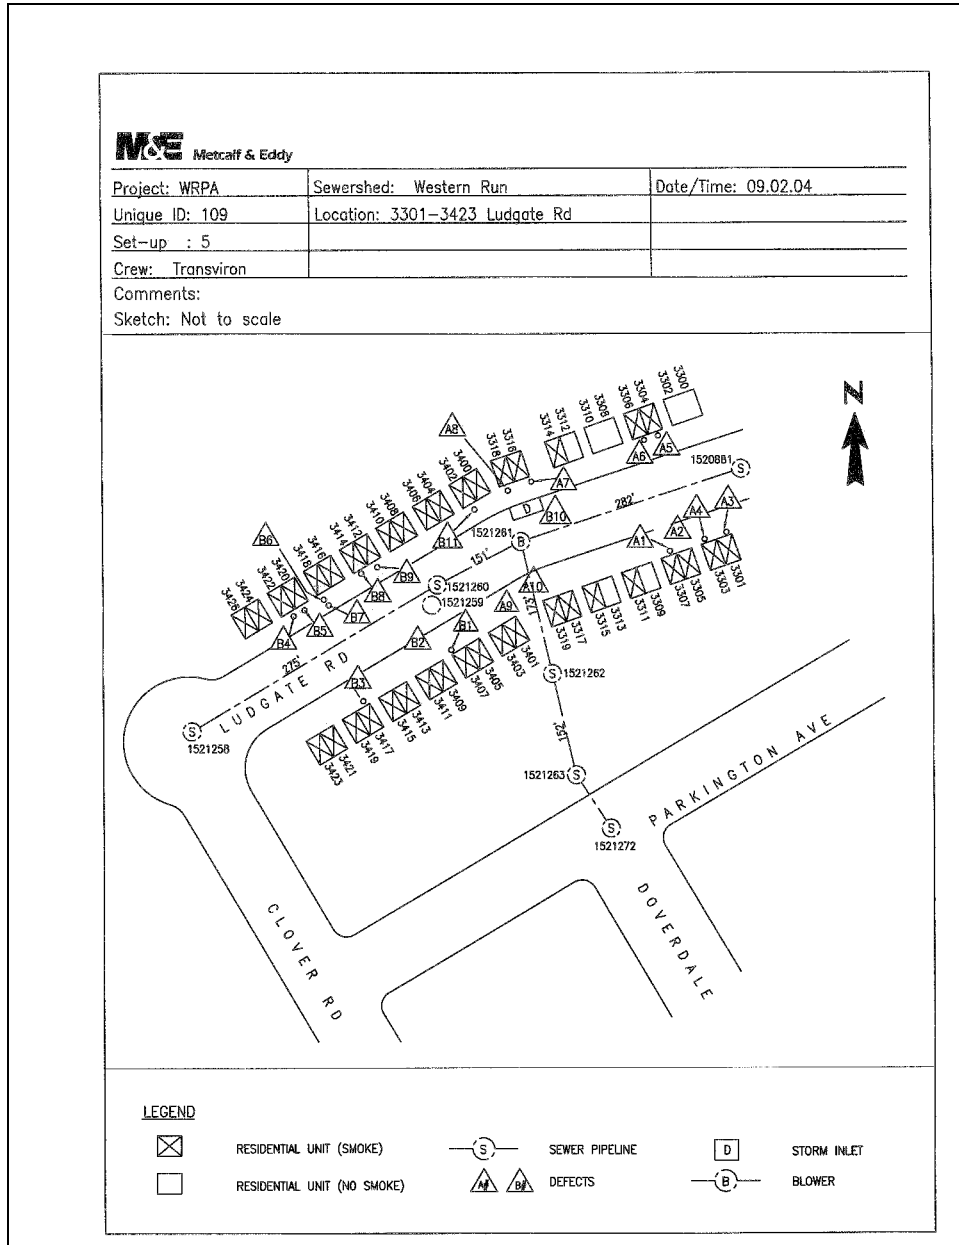

Sketch No: 109

### Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\109.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.





# SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland


<b>Unique Test ID</b>	109	<b>Date:</b>	9/2/2004	<b>MeterBasin:</b>	01_WR22
<b>Observer ID:</b>	B	<b>Crew:</b>	T-1	<b>Dye Test Recommended:</b>	N
<b>Defect No:</b>	8	<b>Setup No:</b>	5	<b>Priority CCTV:</b>	

<b>House Number</b>	<b>Street Prefix:</b>	<b>Street Name:</b>	<b>Street Type:</b>
3414		Ludgate	ROAD

<b>Source Type:</b>	04= Cleanout	<b>Location:</b>	7=Yard-Front	<b>Severity:</b>
<b>Sector:</b>	2=Private	<b>Drainage Area:</b>	0	

**Comments:**

## SMOKE TEST PHOTOS

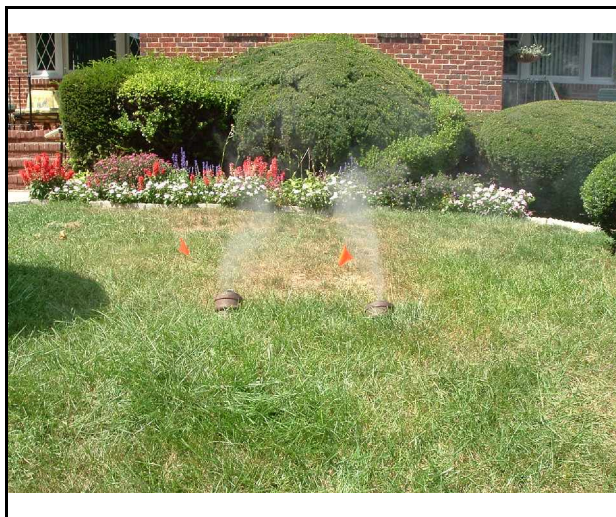


**Photo No:** 43

**Filename Path:**

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke  
Testing\Pictures\0902-2004\T-1\PLAYER\_B\B\_2004\_0902Image0043.JPG

**Image Status:** Image found and displayed.

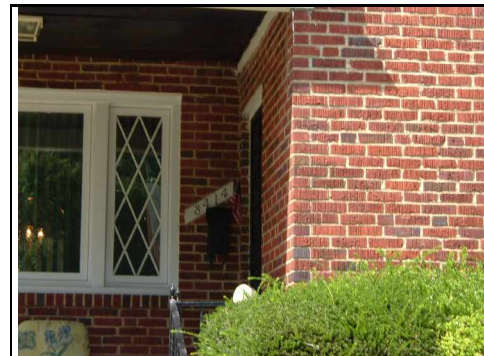

**Photo No:** 44

**Filename Path:**

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke  
Testing\Pictures\0902-2004\T-1\PLAYER\_B\B\_2004\_0902Image0044.JPG

**Image Status:** Image found and displayed.

**Photo No:**

**Filename Path:**


**Image Status:** No image name specified.



# SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

## FIELD SKETCH

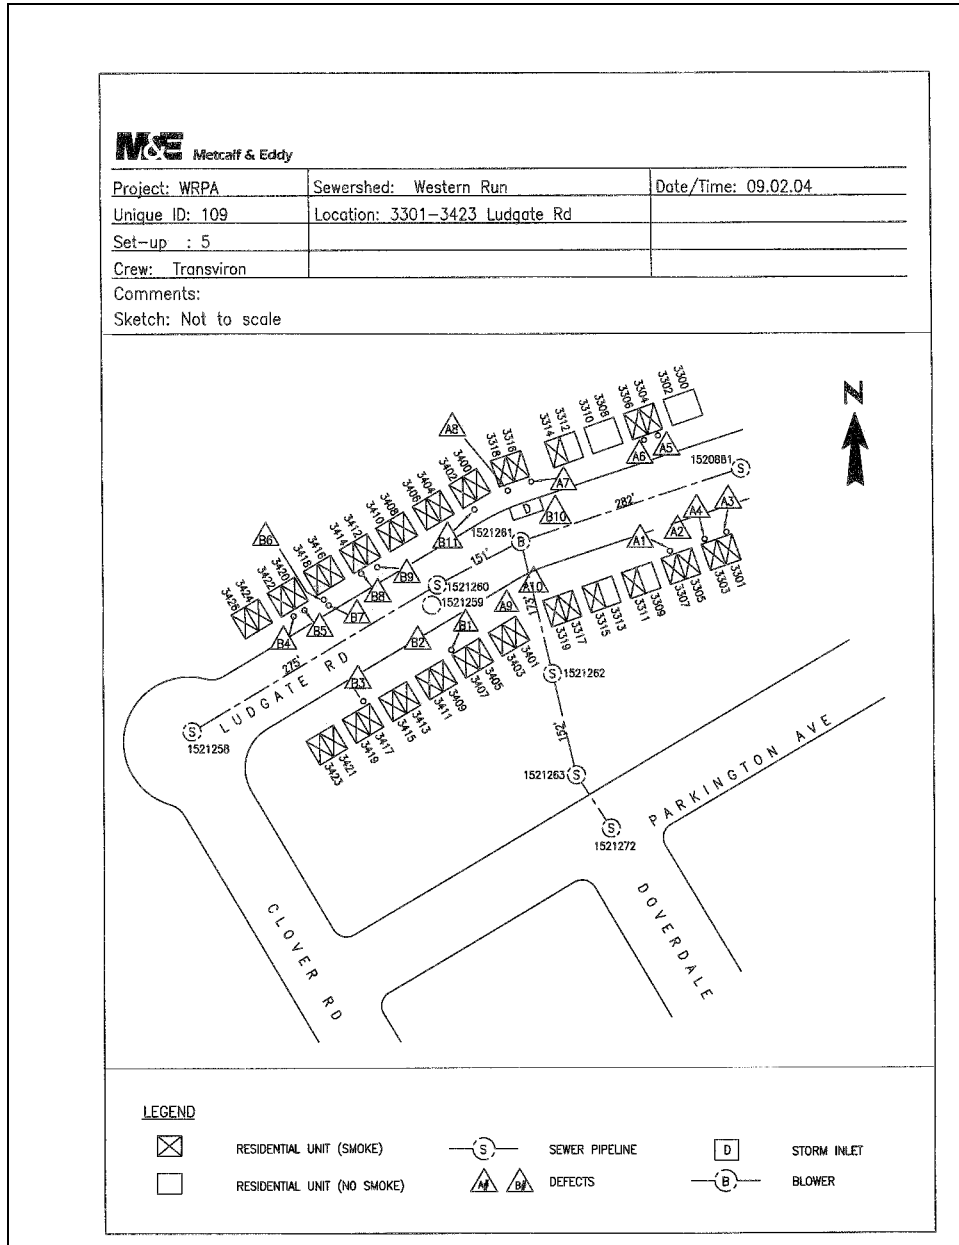

Sketch No: 109

### Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\109.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



# SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland


<b>Unique Test ID</b>	109	<b>Date:</b>	9/2/2004	<b>MeterBasin:</b>	01_WR22
<b>Observer ID:</b>	B	<b>Crew:</b>	T-1	<b>Dye Test Recommended:</b>	N
<b>Defect No:</b>	9	<b>Setup No:</b>	5	<b>Priority CCTV:</b>	

<b>House Number</b>	<b>Street Prefix:</b>	<b>Street Name:</b>	<b>Street Type:</b>
3412		Ludgate	ROAD

<b>Source Type:</b>	04= Cleanout	<b>Location:</b>	7=Yard-Front	<b>Severity:</b>
<b>Sector:</b>	2=Private	<b>Drainage Area:</b>	0	

**Comments:**

## SMOKE TEST PHOTOS

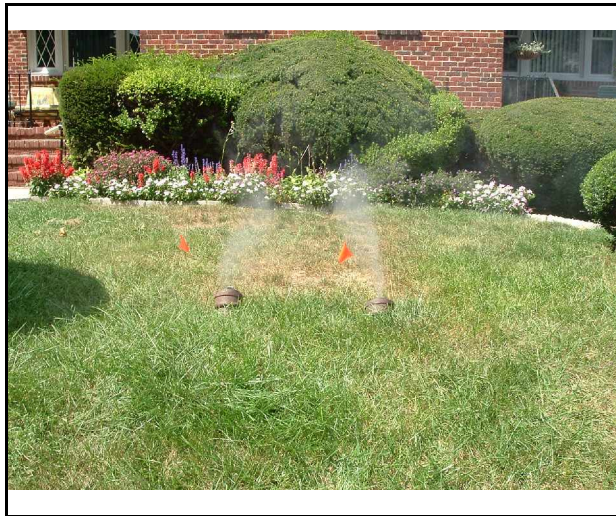

**Photo No:** 43

**Filename Path:**

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke  
Testing\Pictures\0902-2004\T-1\PLAYER\_B\B\_2004\_0902Image0043.JPG

**Image Status:** Image found and displayed.



**Photo No:** 45

**Filename Path:**

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke  
Testing\Pictures\0902-2004\T-1\PLAYER\_B\B\_2004\_0902Image0045.JPG

**Image Status:** Image found and displayed.

**Photo No:**

**Filename Path:**


**Image Status:** No image name specified.



# SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

## FIELD SKETCH

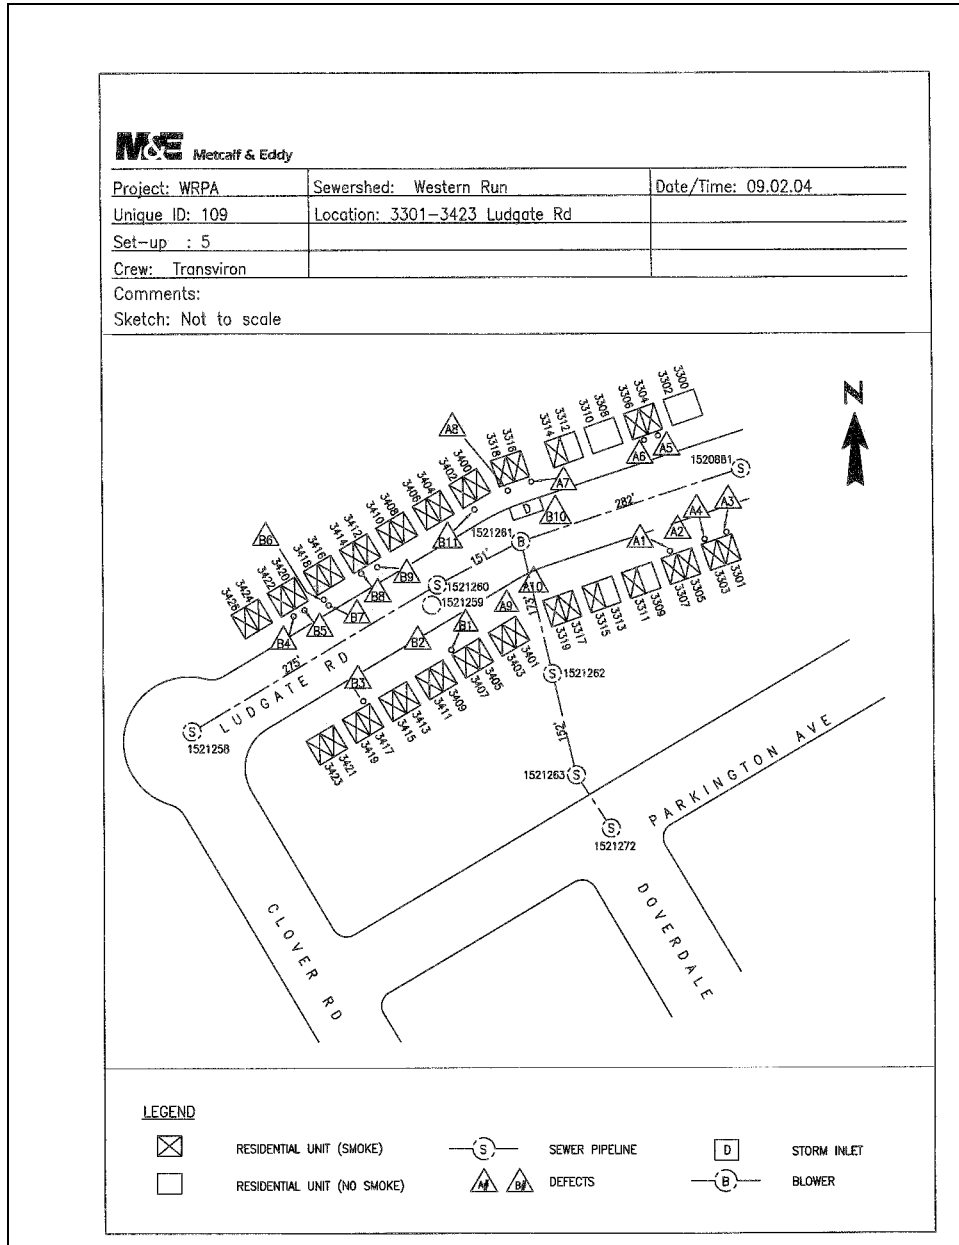

Sketch No: 109

### Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\109.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



# SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

---

<b>Unique Test ID</b>	110	<b>Date:</b>	9/14/2004	<b>MeterBasin:</b>	
<b>Observer ID:</b>	A	<b>Crew:</b>	T-1	<b>Dye Test Recommended:</b>	N
<b>Defect No:</b>	0	<b>Setup No:</b>	1	<b>Priority CCTV:</b>	

---

<b>House Number</b>	<b>Street Prefix:</b>	<b>Street Name:</b>	<b>Street Type:</b>
---------------------	-----------------------	---------------------	---------------------

<b>Source Type:</b>	<b>Location:</b>	<b>Severity:</b>
<b>Sector:</b>	<b>Drainage Area:</b> 0	
<b>Comments:</b> No defects observed		

---

## SMOKE TEST PHOTOS

**Photo No:**

**Filename Path:**

**Image Status:** No image name specified.

**Photo No:**

**Filename Path:**

**Image Status:** No image name specified.

**Photo No:**

**Filename Path:**

**Image Status:** No image name specified.






# SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

## FIELD SKETCH

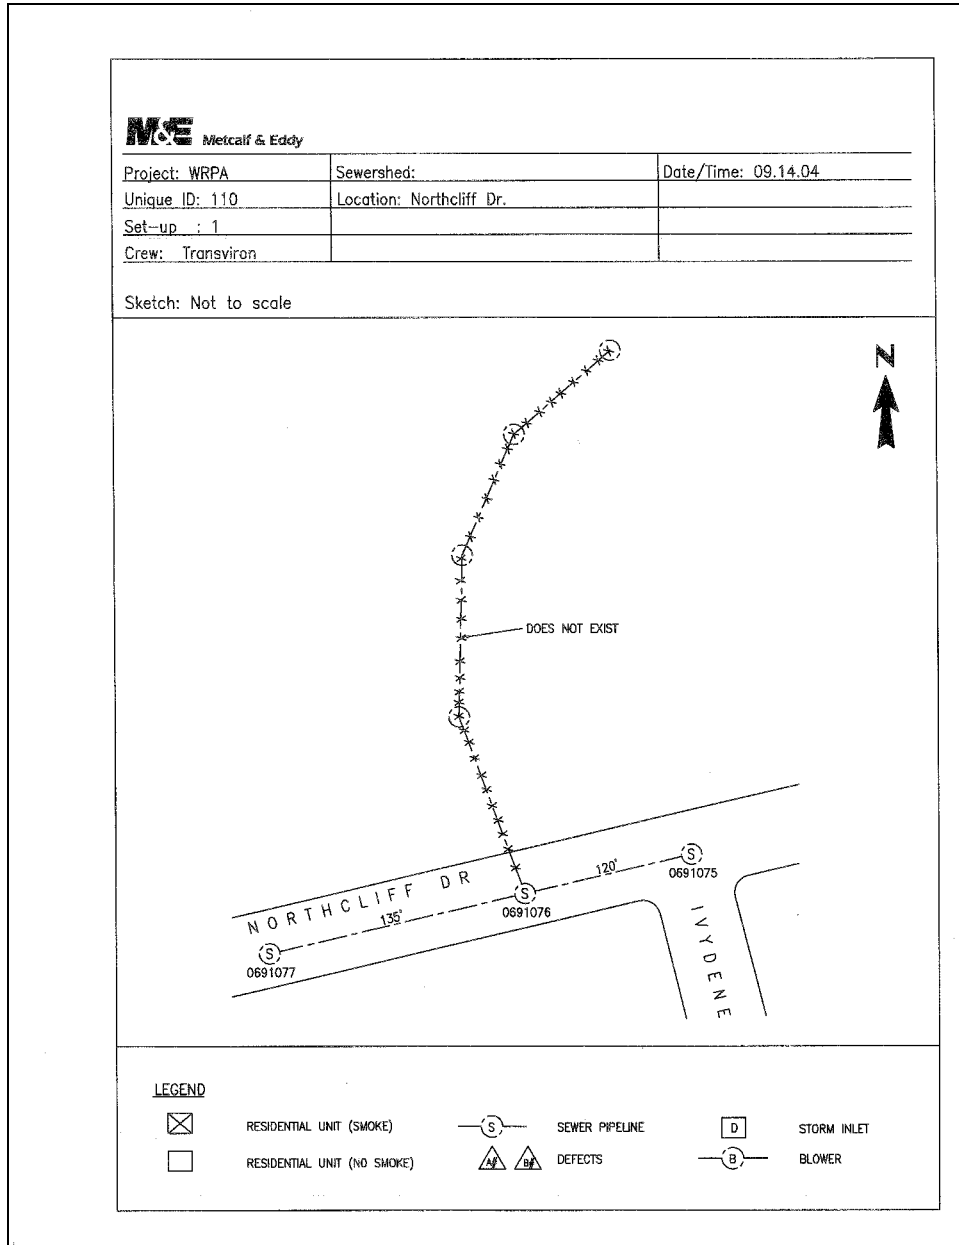

Sketch No: 110

### Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\110.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



# SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

<b>Unique Test ID</b>	111	<b>Date:</b>	9/14/2004	<b>MeterBasin:</b>	01_WRR02
<b>Observer ID:</b>	A	<b>Crew:</b>	T-1	<b>Dye Test Recommended:</b>	N
<b>Defect No:</b>	1	<b>Setup No:</b>	2	<b>Priority CCTV:</b>	


<b>House Number</b>	<b>Street Prefix:</b>	<b>Street Name:</b>	<b>Street Type:</b>
2201		Rogene	DR

<b>Source Type:</b>	12= MH Frame Seal	<b>Location:</b>	14=Other	<b>Severity:</b>
---------------------	-------------------	------------------	----------	------------------

<b>Sector:</b>	1=Public	<b>Drainage Area:</b>	0
----------------	----------	-----------------------	---

**Comments:** location=creek

## SMOKE TEST PHOTOS

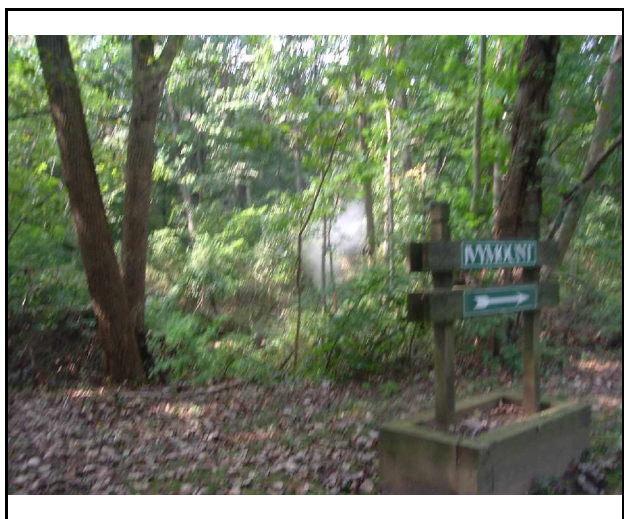

**Photo No:** 3

**Filename Path:**

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke  
Testing\Pictures\0914-2004\T-1\PLAYER\_A\A\_2004\_0914Image0003.JPG

**Image Status:** Image found and displayed.



**Photo No:** 4

**Filename Path:**

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke  
Testing\Pictures\0914-2004\T-1\PLAYER\_A\A\_2004\_0914Image0004.JPG

**Image Status:** Image found and displayed.

**Photo No:**

**Filename Path:**


**Image Status:** No image name specified.



# SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

## FIELD SKETCH

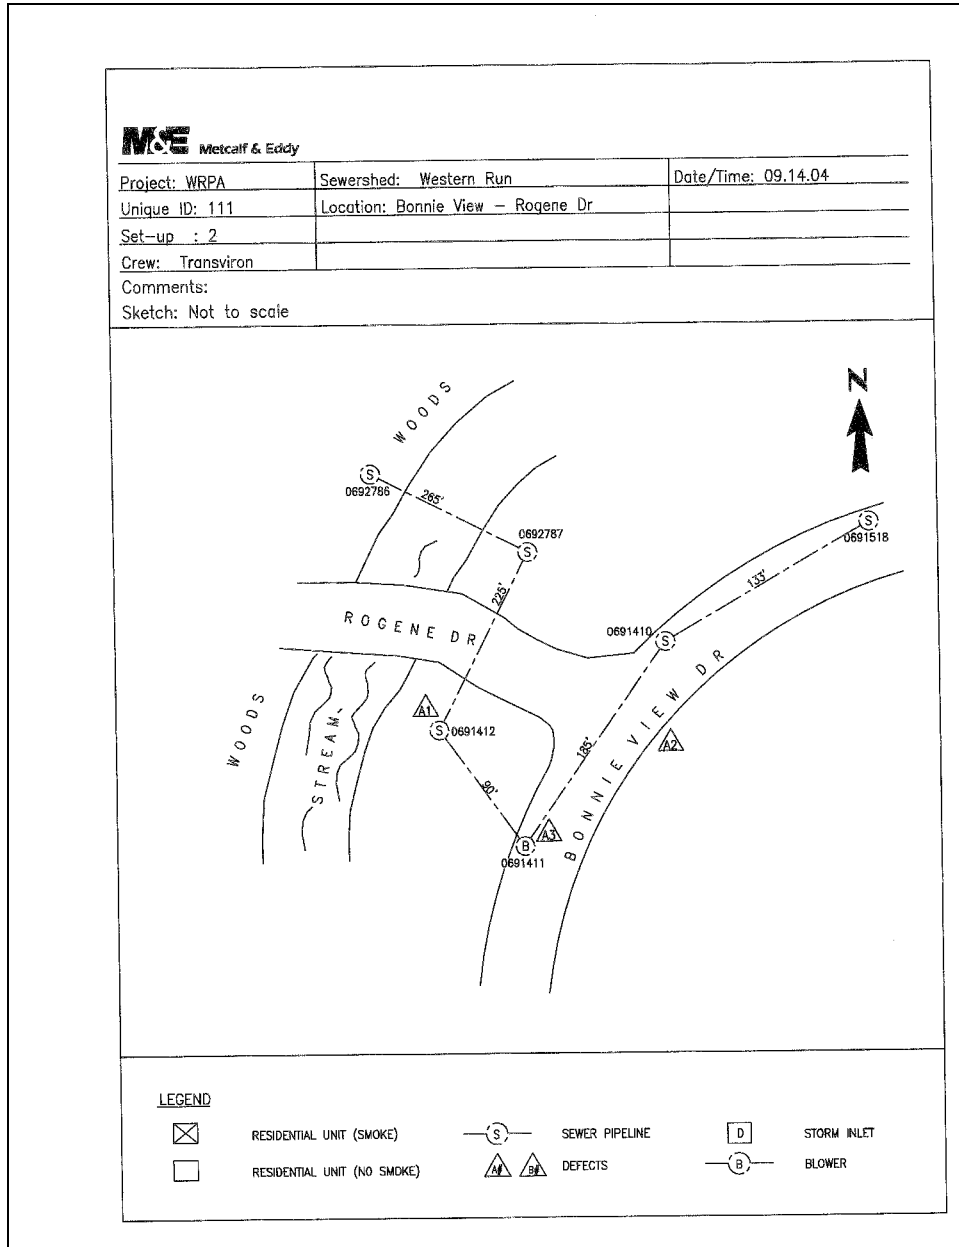

Sketch No: 111

### Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\111.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



# SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland


<b>Unique Test ID</b>	111	<b>Date:</b>	9/14/2004	<b>MeterBasin:</b>	01_WR35
<b>Observer ID:</b>	A	<b>Crew:</b>	T-1	<b>Dye Test Recommended:</b>	N
<b>Defect No:</b>	2	<b>Setup No:</b>	2	<b>Priority CCTV:</b>	

<b>House Number</b>	<b>Street Prefix:</b>	<b>Street Name:</b>	<b>Street Type:</b>
5911		Bonnie View	DR

<b>Source Type:</b>	02= Service Line	<b>Location:</b>	6=Curb	<b>Severity:</b>
<b>Sector:</b>	1=Public	<b>Drainage Area:</b>	8500	

**Comments:** crack in curb possible service connection

## SMOKE TEST PHOTOS

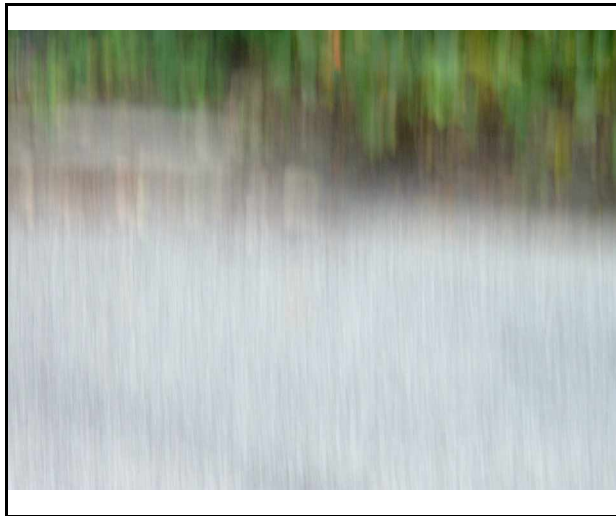

**Photo No:** 5

**Filename Path:**

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke  
Testing\Pictures\0914-2004\T-1\PLAYER\_A\A\_2004\_0914Image0005.JPG

**Image Status:** Image found and displayed.



**Photo No:** 6

**Filename Path:**

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke  
Testing\Pictures\0914-2004\T-1\PLAYER\_A\A\_2004\_0914Image0006.JPG

**Image Status:** Image found and displayed.

**Photo No:**

**Filename Path:**


**Image Status:** No image name specified.



# SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

## FIELD SKETCH

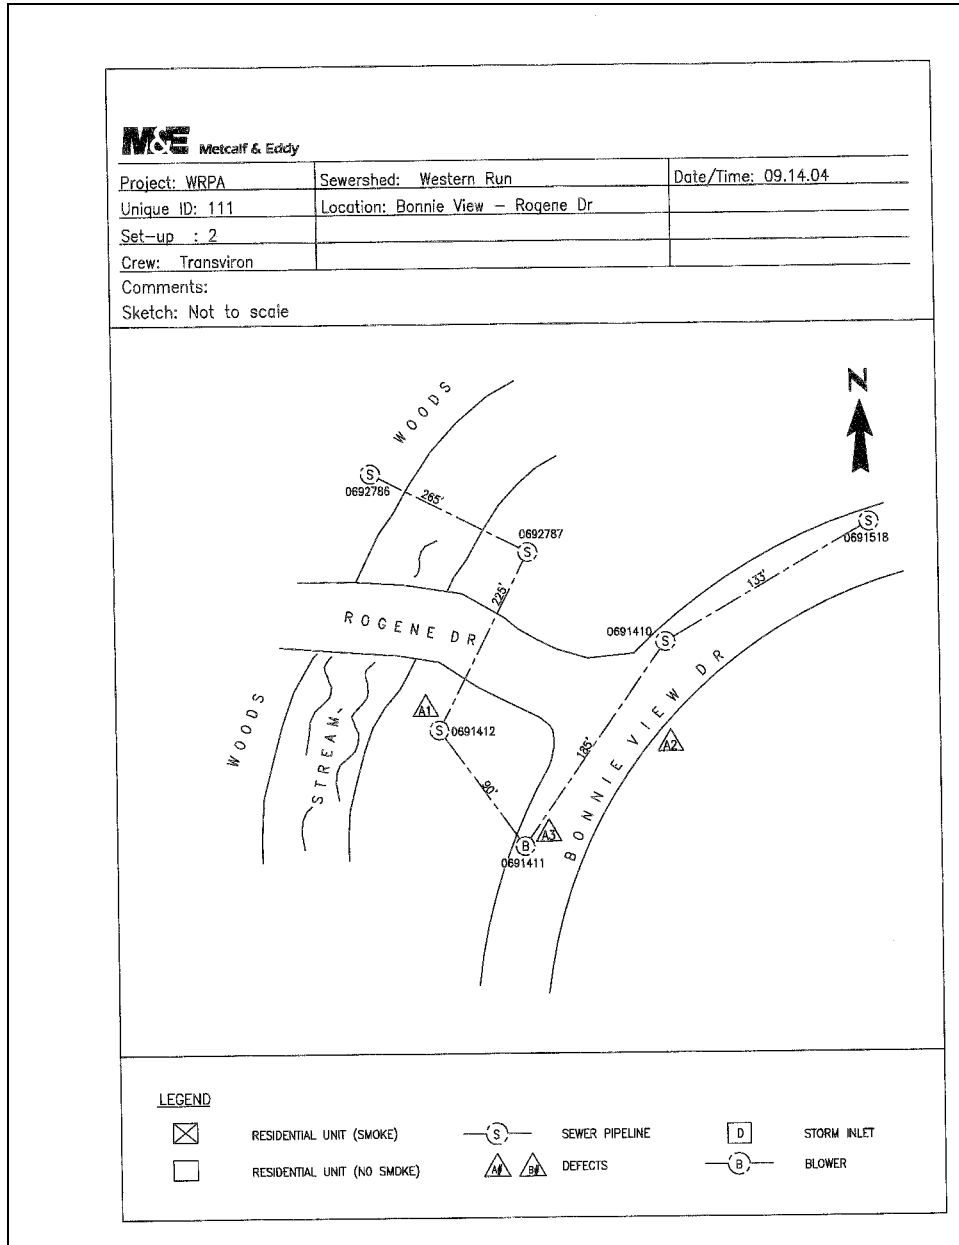

Sketch No: 111

### Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\111.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.





# SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

<b>Unique Test ID</b>	111	<b>Date:</b>	9/14/2004	<b>MeterBasin:</b>	01_WR35
<b>Observer ID:</b>	A	<b>Crew:</b>	T-1	<b>Dye Test Recommended:</b>	N
<b>Defect No:</b>	3	<b>Setup No:</b>	2	<b>Priority CCTV:</b>	

<b>House Number</b>	<b>Street Prefix:</b>	<b>Street Name:</b>	<b>Street Type:</b>
5911		Bonnie View	DR

<b>Source Type:</b>	01= Main Sewer	<b>Location:</b>	2=Paved Asphalt	<b>Severity:</b>
<b>Sector:</b>	1=Public	<b>Drainage Area:</b>	6000	

**Comments:** crack in street located at a patch

## SMOKE TEST PHOTOS



**Photo No:** 7

**Filename Path:**

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke  
Testing\Pictures\0914-2004\T-1\PLAYER\_A\A\_2004\_0914Image0007.JPG

**Image Status:** Image found and displayed.



**Photo No:** 8

**Filename Path:**

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke  
Testing\Pictures\0914-2004\T-1\PLAYER\_A\A\_2004\_0914Image0008.JPG

**Image Status:** Image found and displayed.

**Photo No:**

**Filename Path:**


**Image Status:** No image name specified.



# SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

## FIELD SKETCH

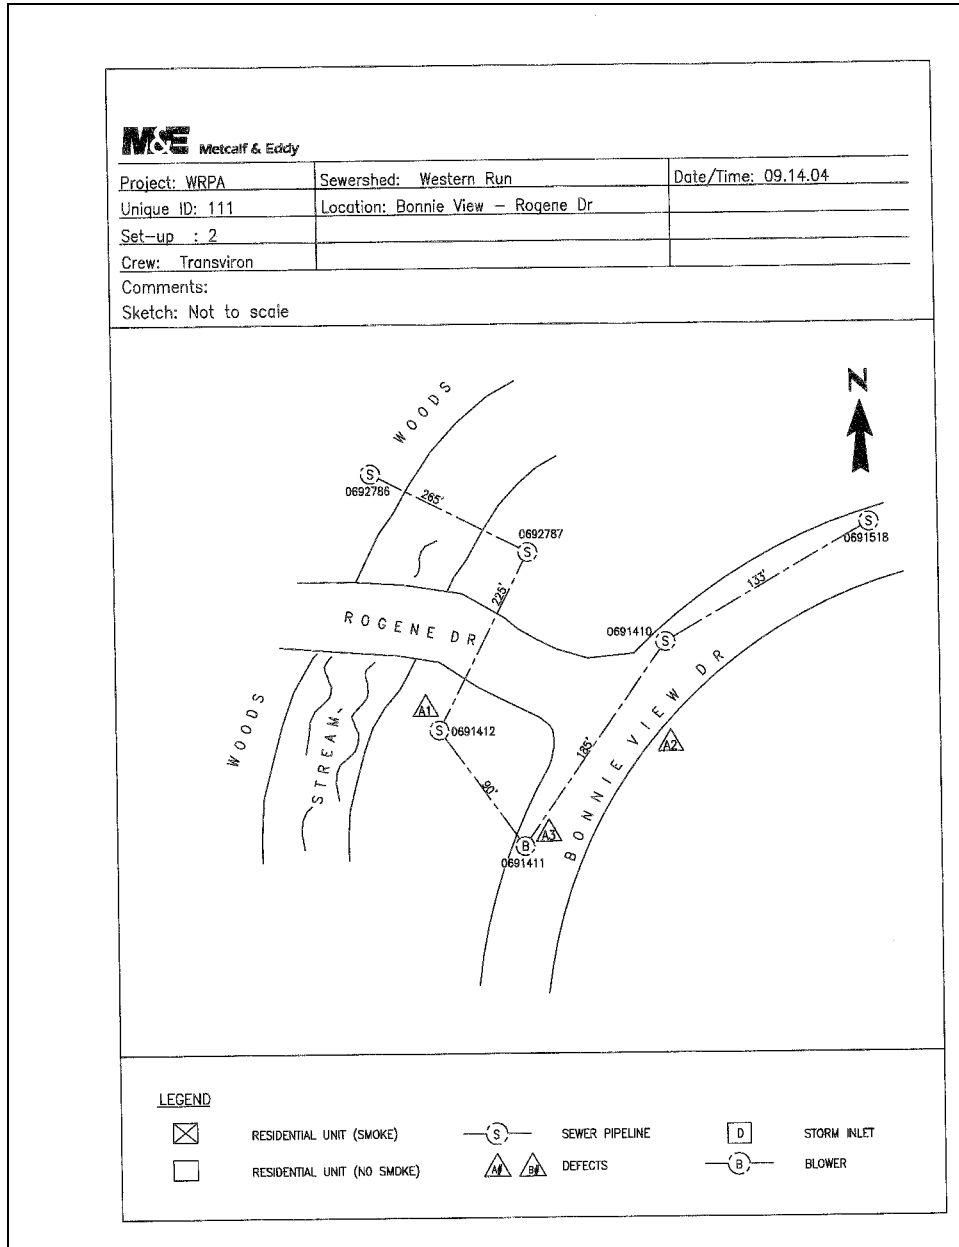

Sketch No: 111

### Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\111.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



# SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

<b>Unique Test ID</b>	112	<b>Date:</b>	9/14/2004	<b>MeterBasin:</b>	01_WR35
<b>Observer ID:</b>	A	<b>Crew:</b>	T-1	<b>Dye Test Recommended:</b>	Y
<b>Defect No:</b>	1	<b>Setup No:</b>	3	<b>Priority CCTV:</b>	

<b>House Number</b>	5911	<b>Street Prefix:</b>		<b>Street Name:</b>	Bonnie View	<b>Street Type:</b>	DR
<b>Source Type:</b>	13= Storm Main	<b>Location:</b>	6=Curb	<b>Severity:</b>			
<b>Sector:</b>	1=Public	<b>Drainage Area:</b>	5200				
<b>Comments:</b>	drainage=street						

## SMOKE TEST PHOTOS



**Photo No:**

**Filename Path:**

**Image Status:** No image name specified.

**Photo No:** 9

**Filename Path:**

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke  
Testing\Pictures\0914-2004\T-1\PLAYER\_A\A\_2004\_0914Image0009.JPG

**Image Status:** Image found and displayed.

**Photo No:**

**Filename Path:**


**Image Status:** No image name specified.



# SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

## FIELD SKETCH

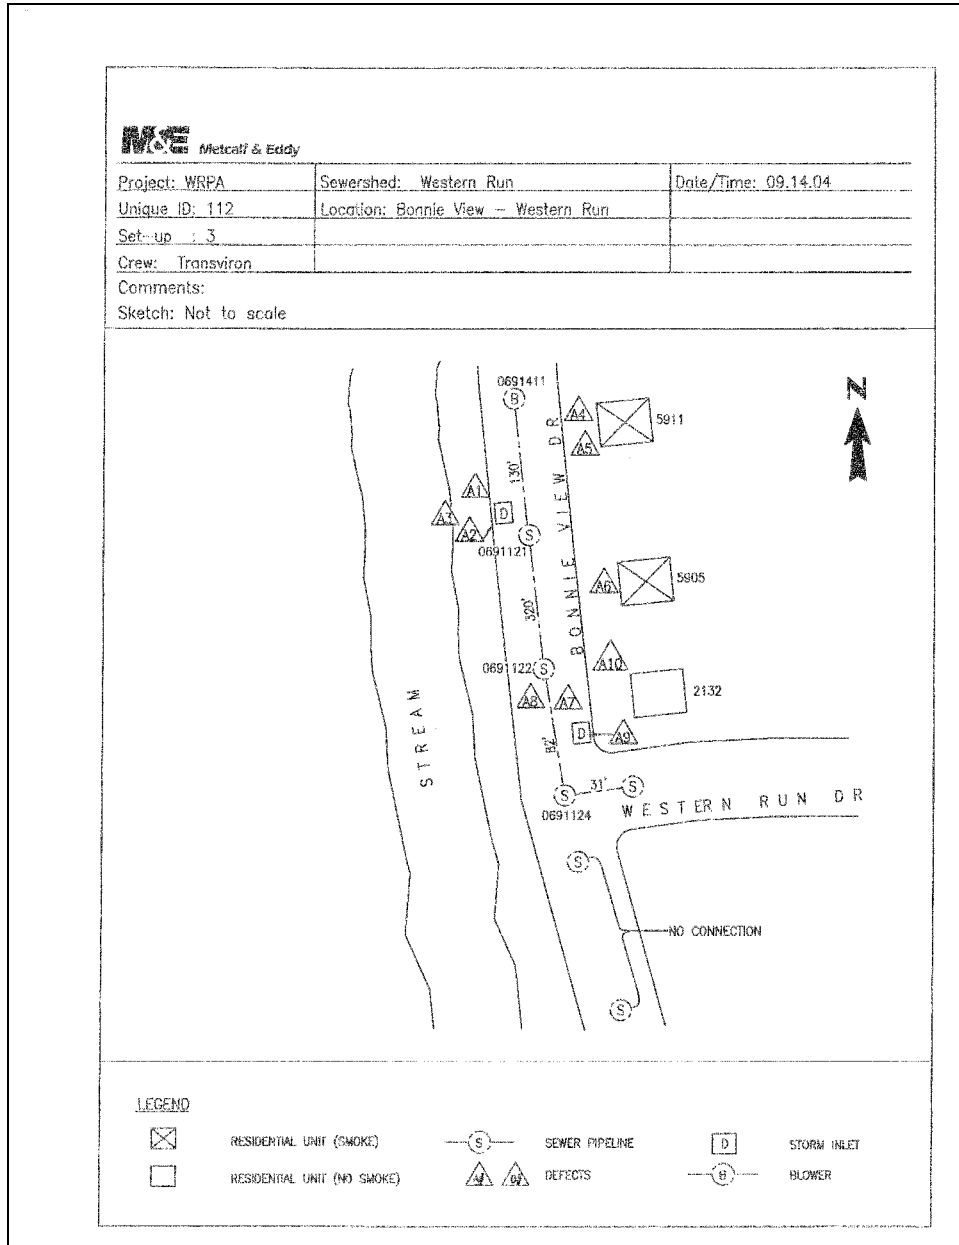

Sketch No: 112

### Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\112.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



# SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

<b>Unique Test ID</b>	112	<b>Date:</b>	9/14/2004	<b>MeterBasin:</b>	01_WRR02
<b>Observer ID:</b>	A	<b>Crew:</b>	T-1	<b>Dye Test Recommended:</b>	N
<b>Defect No:</b>	10	<b>Setup No:</b>	3	<b>Priority CCTV:</b>	

<b>House Number</b>	<b>Street Prefix:</b>	<b>Street Name:</b>	<b>Street Type:</b>
2132		Western Run	DR

<b>Source Type:</b>	18= Other	<b>Location:</b>	4=Driveway	<b>Severity:</b>
<b>Sector:</b>	1=Public	<b>Drainage Area:</b>	200	

**Comments:**

## SMOKE TEST PHOTOS



**Photo No:** 21

**Filename Path:**

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke  
Testing\Pictures\0914-2004\T-1\PLAYER\_A\A\_2004\_0914Image0021.JPG

**Image Status:** Image found and displayed.



**Photo No:** 22

**Filename Path:**

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke  
Testing\Pictures\0914-2004\T-1\PLAYER\_A\A\_2004\_0914Image0022.JPG

**Image Status:** Image found and displayed.

**Photo No:**

**Filename Path:**

**Image Status:** No image name specified.






# SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

## FIELD SKETCH

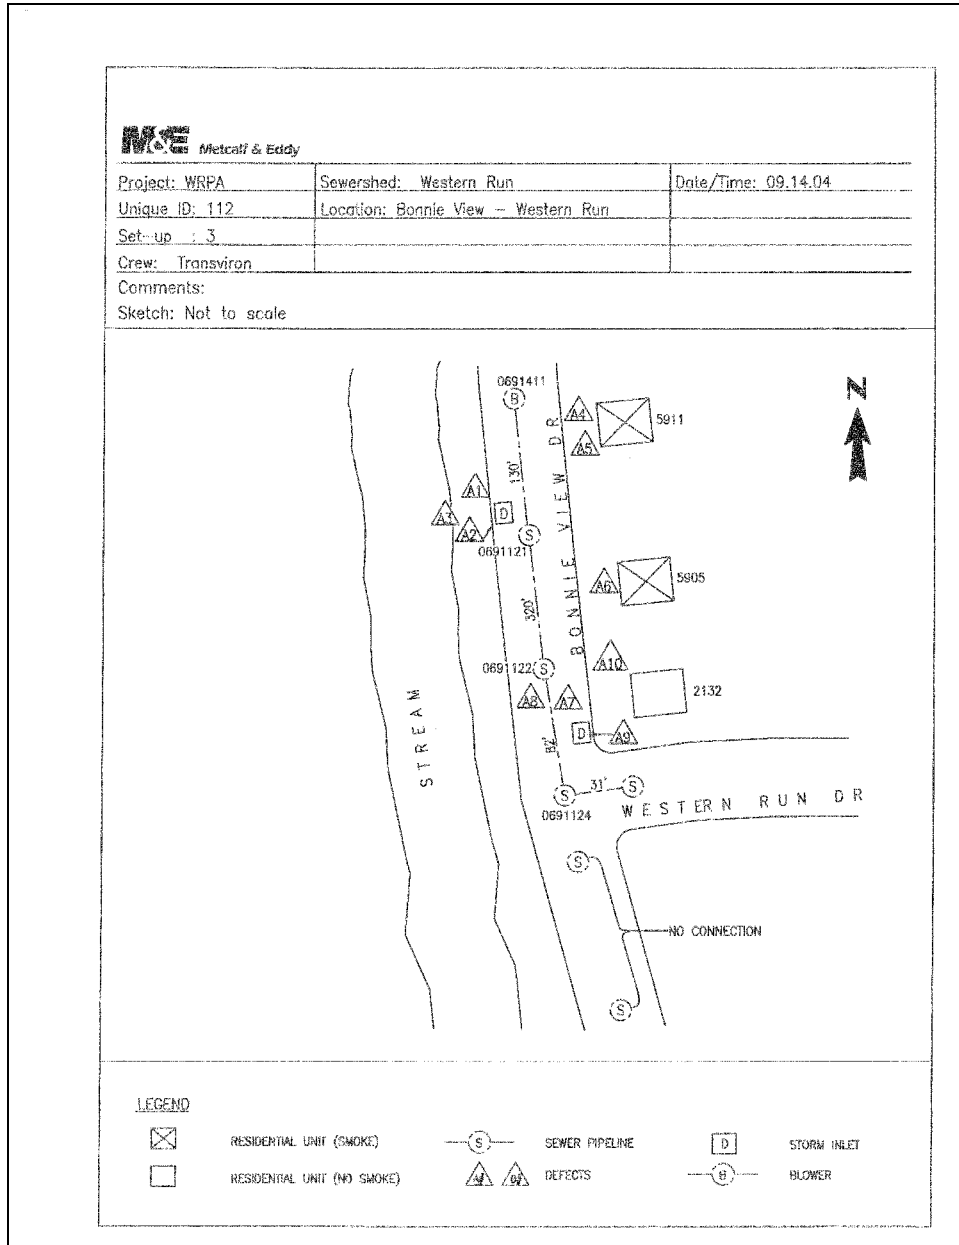

Sketch No: 112

### Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\112.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



# SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

<b>Unique Test ID</b>	112	<b>Date:</b>	9/14/2004	<b>MeterBasin:</b>	01_WR35
<b>Observer ID:</b>	A	<b>Crew:</b>	T-1	<b>Dye Test Recommended:</b>	Y
<b>Defect No:</b>	2	<b>Setup No:</b>	3	<b>Priority CCTV:</b>	

<b>House Number</b>	<b>Street Prefix:</b>	<b>Street Name:</b>	<b>Street Type:</b>	
5911		Bonnie View	DR	
<b>Source Type:</b>	14= Catch Basin	<b>Location:</b>	6=Curb	<b>Severity:</b>
<b>Sector:</b>	1=Public	<b>Drainage Area:</b>	7500	
<b>Comments:</b>	drainage=street			

## SMOKE TEST PHOTOS



**Photo No:**

**Filename Path:**

**Image Status:** No image name specified.

**Photo No:** 10

**Filename Path:**

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke  
Testing\Pictures\0914-2004\T-1\PLAYER\_A\A\_2004\_0914Image0010.JPG

**Image Status:** Image found and displayed.

**Photo No:**

**Filename Path:**


**Image Status:** No image name specified.



# SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

## FIELD SKETCH

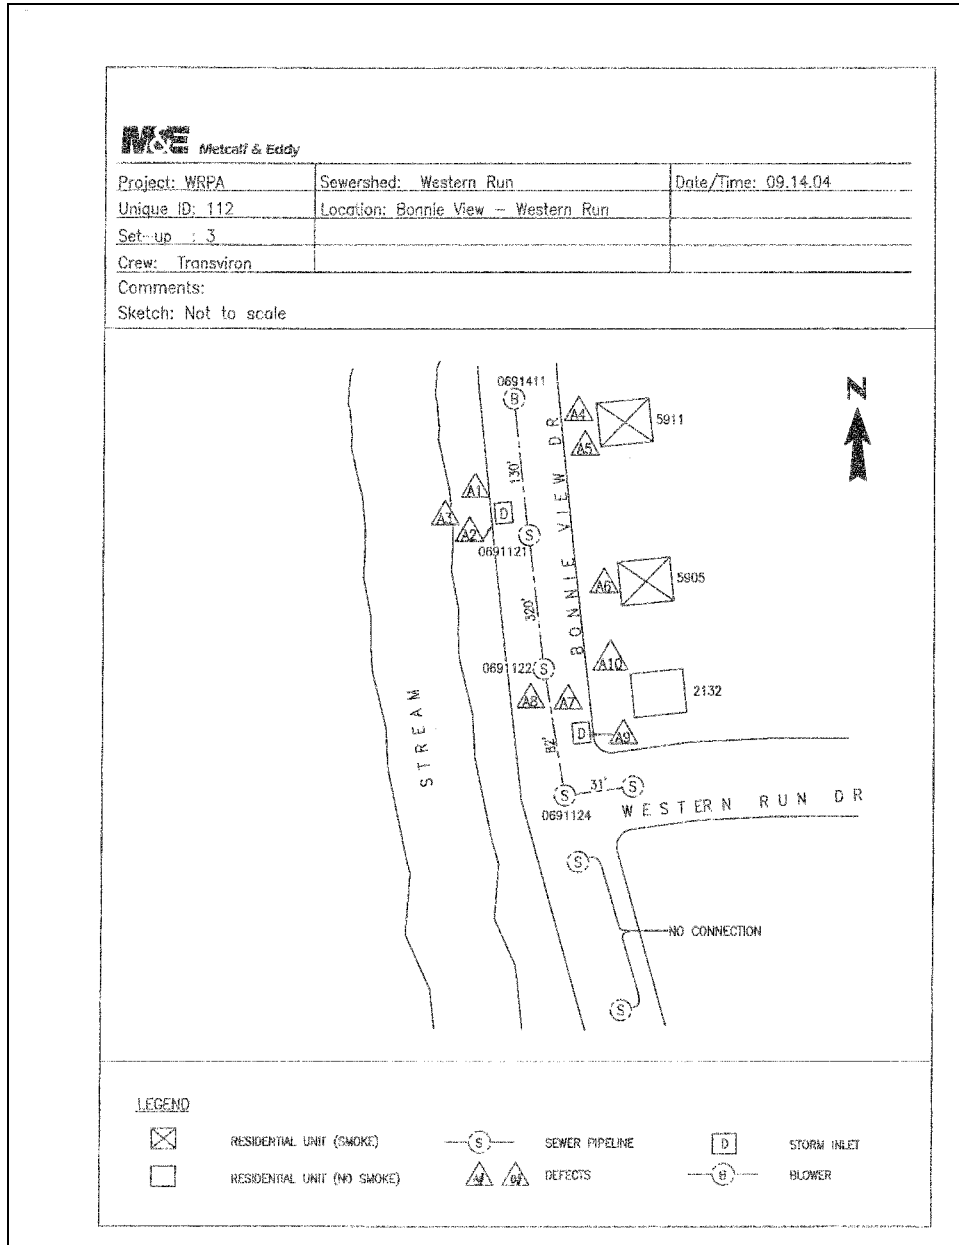

Sketch No: 112

### Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\112.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



# SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

<b>Unique Test ID</b>	112	<b>Date:</b>	9/14/2004	<b>MeterBasin:</b>	01_WRR02
<b>Observer ID:</b>	A	<b>Crew:</b>	T-1	<b>Dye Test Recommended:</b>	Y
<b>Defect No:</b>	3	<b>Setup No:</b>	3	<b>Priority CCTV:</b>	

<b>House Number</b>	<b>Street Prefix:</b>	<b>Street Name:</b>	<b>Street Type:</b>
5911		Bonnie View	DR

<b>Source Type:</b>	13= Storm Main	<b>Location:</b>	14=Other	<b>Severity:</b>
<b>Sector:</b>	1=Public	<b>Drainage Area:</b>	0	

**Comments:** 14=creek located across the street from 5911 Bonnie View Dr

## SMOKE TEST PHOTOS



**Photo No:**

**Filename Path:**

**Image Status:** No image name specified.

**Photo No:** 11

**Filename Path:**

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke  
Testing\Pictures\0914-2004\T-1\PLAYER\_A\A\_2004\_0914Image0011.JPG

**Image Status:** Image found and displayed.

**Photo No:**

**Filename Path:**


**Image Status:** No image name specified.



# SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

## FIELD SKETCH

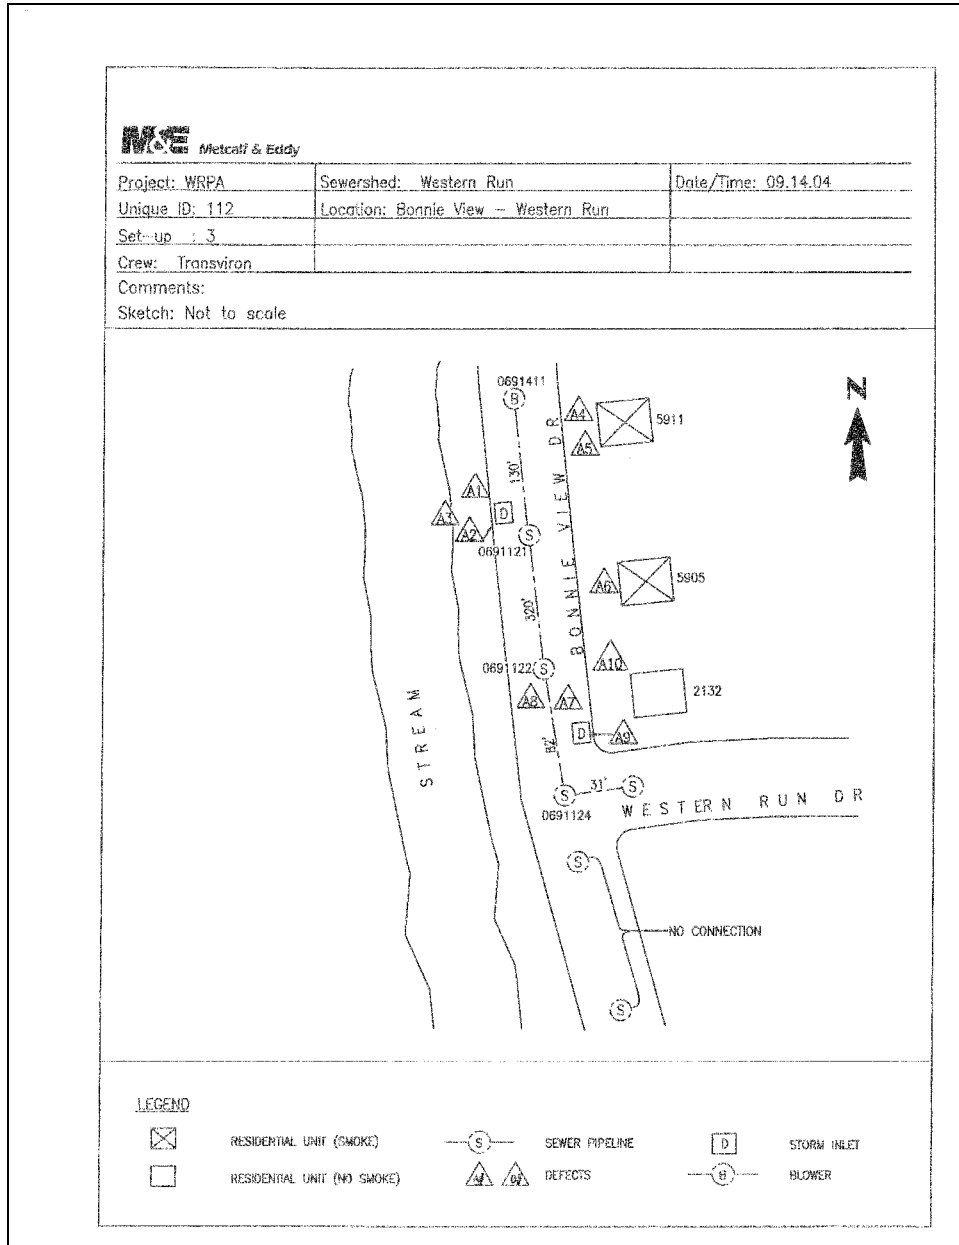

Sketch No: 112

### Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\112.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.





# SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

<b>Unique Test ID</b>	112	<b>Date:</b>	9/14/2004	<b>MeterBasin:</b>	01_WR35
<b>Observer ID:</b>	A	<b>Crew:</b>	T-1	<b>Dye Test Recommended:</b>	N
<b>Defect No:</b>	4	<b>Setup No:</b>	3	<b>Priority CCTV:</b>	

<b>House Number</b>	<b>Street Prefix:</b>	<b>Street Name:</b>	<b>Street Type:</b>
5911		Bonnie View	DR

<b>Source Type:</b>	04= Cleanout	<b>Location:</b>	7=Yard-Front	<b>Severity:</b>
<b>Sector:</b>	2=Private	<b>Drainage Area:</b>	0	

**Comments:**

## SMOKE TEST PHOTOS



**Photo No:** 12

**Filename Path:**

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke  
Testing\Pictures\0914-2004\T-1\PLAYER\_A\A\_2004\_0914Image0012.JPG

**Image Status:** Image found and displayed.



**Photo No:** 14

**Filename Path:**

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke  
Testing\Pictures\0914-2004\T-1\PLAYER\_A\A\_2004\_0914Image0014.JPG

**Image Status:** Image found and displayed.

**Photo No:**

**Filename Path:**


**Image Status:** No image name specified.



# SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

## FIELD SKETCH

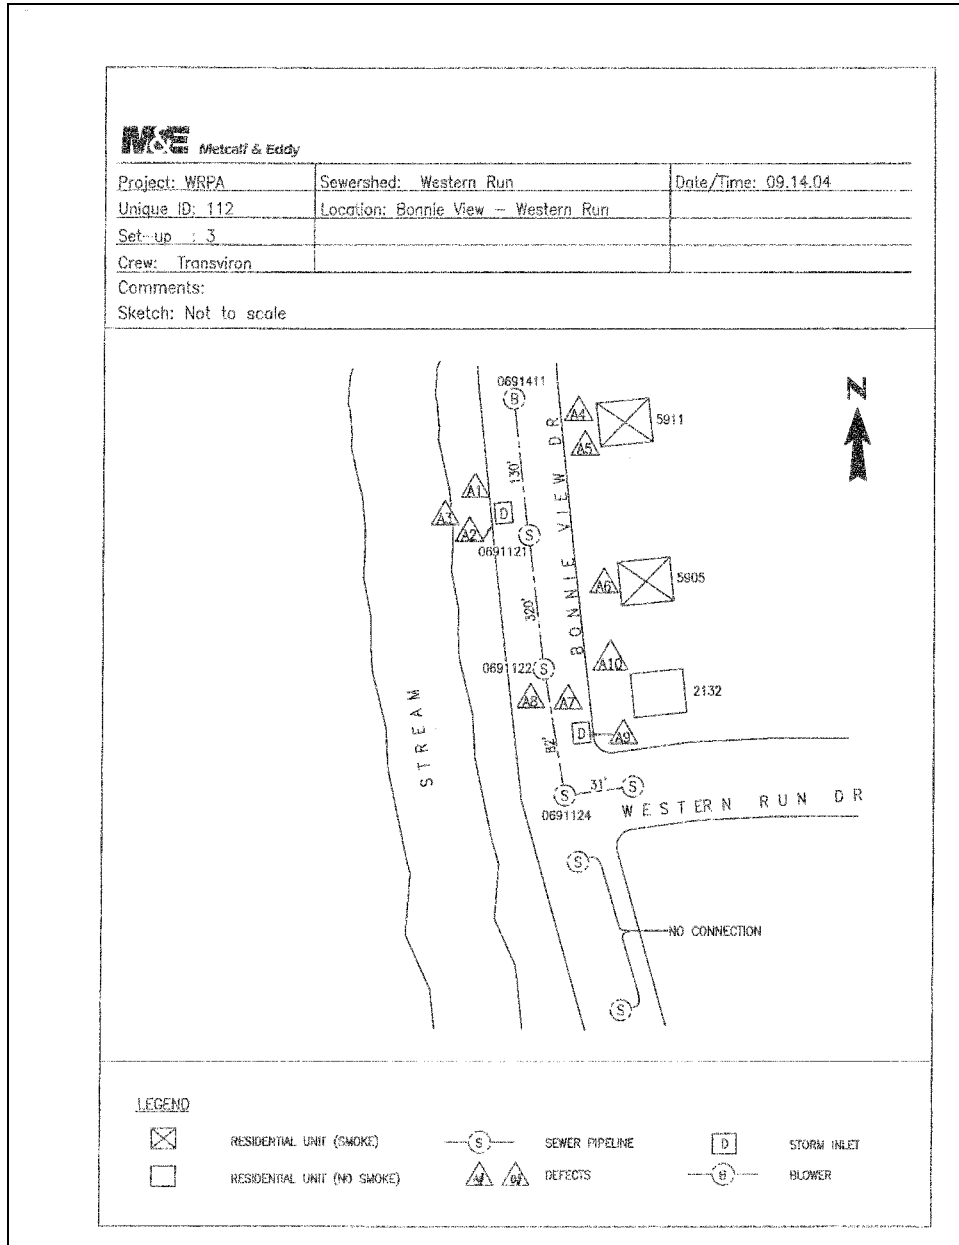

Sketch No: 112

### Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\112.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.